



Technical Service Bulletin

01 MIL on or found during diagnostic work, DTC P201500 stored in the ECM

01 20 87 2057831/3 September 15, 2020. Supersedes Technical Service Bulletin Group 01 number 20-51 dated March 25, 2020 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A4 allroad	2018 - 2019	All	2.0 liter
A4, A5, A5 Cabriolet, and A5 Sportback	2018 - 2020	All	2.0 liter

Condition

REVISION HISTORY		
Revision	Date	Purpose
3	-	Revised <i>Production</i> (Removed Statement)
2	03/20/2020	Revised <i>Warranty</i> (Updating Damage Code)
1	12/03/2019	Initial publication

Customer concern:

- MIL on.

Or

- No customer concerns, it is found during PDI or any other diagnostic work.

Workshop findings:

The following DTC may be stored in the engine control module (ECM), J623 (address word 0001):

- **DTC P201500** (sender for intake manifold flap position/air flow control, implausible signal, sporadic) with symptom code 2967.

Technical Background

Due to a sporadic wrong initialization of the airflow control flap DTC P201500 (sporadic) is stored in the ECM.

A MIL on customer concern is usually caused by additional DTC's stored in the ECM.



Technical Service Bulletin

Production Solution

Not applicable.

Service

Scenario 1

DTC P201500 (sporadic) stored in the ECM only:

- Do not perform the Guided Fault Finding test plan, erase the DTC, and return the vehicle to the customer.



Note:

Parts replacement does not solve this issue. Claims for replaced parts will be subject to review.

Scenario 2

DTC P201500 (sporadic) and there are additional DTC's stored in the ECM:

1. Erase DTC P201500.
2. Perform Guided Fault Finding for other DTC's stored in engine control module.

Scenario 3

DTC P201500 (static) stored in the ECM:

- A static entry of this DTC indicates a failure and GFF should be performed in this case.

Warranty

Claim Type:	<ul style="list-style-type: none">• 110 up to 48 Months/50,000 Mile.• G10 for CPO Covered Vehicles – Verify Owner.• If the vehicle is outside any warranty, this Technical Service Bulletin is informational only.
Service Number:	2465
Damage Code:	0040



Technical Service Bulletin

Diagnostic Time:	GFF	0150 0000	Time stated on the diagnostic protocol (Max 20 TU)
	Road test prior to the service procedure	No allowance	0 TU
	Road test after the service procedure	No allowance	0 TU
Claim Comment:	As per TSB #2057831/2		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

All parts and service references provided in this TSB (2057831) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2020 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.