



# Technical Service Bulletin

## PSS 90 Audi adaptive light, pre sense, or Adaptive Cruise Assist malfunction, DTC B200FF9 stored in the driver assist

90 20 67 2055906/3 September 11, 2020. Supersedes Technical Service Bulletin Group 90 number 20-58 dated July 15, 2020 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A6, A7, A8, Q8, and Audi e-tron quattro	2019 - 2020	All	Not Applicable

## Condition

REVISION HISTORY		
Revision	Date	Purpose
3	-	Revised <i>Service</i> (Updated expected SW release date)
2	07/15/2020	Revised <i>Production Solution</i> (Added expected SW release date) Revised <i>Service</i> (Added expected SW release date)
1	08/14/2019	Initial publication

### Customer states:

- An Audi adaptive light or a pre sense malfunction is displayed in the instrument cluster.
- The Adaptive Cruise Assist feature does not work.

### Workshop findings:

The following DTC is stored in the control module for driver assist systems, J1121 (address word 00A5):

- **DTC B200FF9** (internal problem) with symptom code 2117711 and is sporadic.

## Technical Background

The software diagnostic is too sensitive.

## Production Solution

An optimized software is expected to be available in Q1 of 2021.



# Technical Service Bulletin

---

## Service

1. Clear the DTCs. After clearing the DTCs, the concern will be temporarily fixed. However, the problem might reoccur until a permanent solution is available.
2. Explain to the customer that a solution is forthcoming for 1<sup>st</sup> quarter of 2021 and that no repairs are necessary at this point. Do not replace any components for this condition since this will not resolve the customer's concern.
3. Create a PSS record in the PSS application through the Pending Service Solutions (PSS) link in AccessAudi (under *Related Links >> Service*), or through the Technical Assistance page in Elsa.

## Warranty

<b>Claim Type:</b>	<ul style="list-style-type: none"><li>• 110 up to 48 Months/50,000 Miles.</li><li>• G10 for CPO Covered Vehicles – Verify Owner.</li><li>• If the vehicle is outside any warranty, this Technical Service Bulletin is informational only.</li></ul>		
<b>Service Number:</b>	9091		
<b>Damage Code:</b>	0039		
<b>Diagnostic Time:</b>	GFF – Checking and clearing fault codes included in existing labor operations	0151 0000	Time stated on the diagnostic protocol (Max 20 TU)
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	No allowance	0 TU
<b>Claim Comment:</b>	As per TSB #2055906/3		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

## Additional Information

All part and service references provided in this TSB (2055906) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.



# Technical Service Bulletin

---

©2020 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.