



Subject: X12 Alternator Cable Support Bracket Shim Retrofit								
Field Change Program:	FCP Number:	Revision:	Date:					
Field Campaign	484	Α	09/17/2020					
Coach Section:	P/N:		Type:					
07- Electrical	07-10-0	0023	Product Integrity					

Application:

Coach Model	Model Year	VIN
D45CRT-LE	2019	81015, 81016, 81038
J4500	2020	68536, 69195, 69367, 69371, 69372, 69376 - 69378, 69382 - 69391, 69393 - 69395, 69431, 69436 - 69440, 69469, 69470, 69529 - 69541, 69554 - 69555, 69557, 69559 - 69571, 69574 - 69576, 69579 - 69587, 69591 - 69651, 69653 - 69658, 69661 - 69664, 69669 - 69696, 69698 - 69703, 69707 - 69745, 69747 - 69767, 69771 - 69779, 69783 - 69792, 69795 - 69802, 69805 - 69811, 69814 - 69820, 69826 - 69833, 69836 - 69840, 69847 - 69868, 69871, 69872, 69875 - 69885, 69889 - 69891

This field campaign does not necessarily apply to all the above-mentioned coaches. The owners of the coaches affected by this field campaign will be advised by a letter indicating the Vehicle Identification Number (VIN) of each applicable coach.

MARNING

Read this entire procedure before beginning work.

Use Safe Shop Practices at All Times.

To avoid personal injury:

- a. Proper Personal Protective Equipment (PPE) must be worn. Safety glasses and protective gloves are required for working with DEF Fluid.
- b. Turn the main battery disconnect switch to the OFF position.
- c. Ensure that both the front and the rear wheels are chocked.
- d. Position the ENGINE RUN and ENGINE START switches on the engine compartment remote control box to the OFF position.
- e. Allow enough time for components to cool down <u>prior to working</u> in the engine compartment.



1.0 Description

Customer complaint:

Motor Coach Industries (MCI) has become aware that, on certain J4500 and D45CRT-LE, coaches equipped with Cummins X12 engine, the top alternator power and ground cables may potentially come in contact with the edge of the clamp mounting bracket.

<u>Cause</u>:

The support bracket is out of specification.

Corrective action:

MCI recommends owners of the affected coaches have the following procedure performed to add a shim between the mounting bracket and the clamp.

2.0 Material requirements

17	ГЕМ	PART NO	QTY	U/M	DESCRIPTION
1		07-10-2327	1	EA	Spacer- Bracket assy, Alt. Top, Gnd and Pwr Cable

3.0 Special tools

Adhesive Loctite 243, MCI P/N: 23-02-0088.

4.0 Procedure

Open the engine door and locate the clamp securing the top alternator ground and power cables.







Loosen the bolt securing the clamp. Ensure not to remove the bolt completely.



Apply Loctite 243, MCI P/N: 23-02-0088, on the exposed threads.

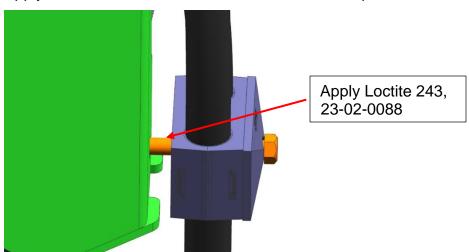

Insert the shim between the mounting bracket and clamp. Re-tighten the bolt and torque it to 80 inch-lbs.

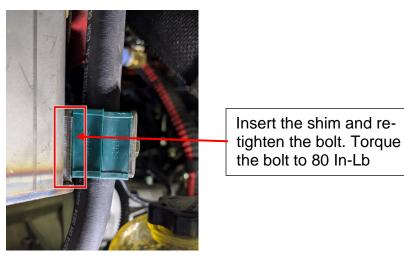



5.0 Field Change Program Conditions:

The part required for this change will be supplied without charge.

A labor allowance of 0.5 hours will be granted for the rework.

This labor allowance will be credited to your MCI Fleet Support Parts Account on receipt of the attached "MCI Field Change Program Verification Form" and a "Warranty Claim Form" as detailed in your Owner Warranty manual to MCI's Warranty department. A "MCI Field Change Program Verification Form" needs to be submitted for each VIN affected. Photocopy the attached "MCI Field Change Program Verification Form" as required for the number of affected coaches in your fleet.

This program will end on September 16, 2021.

Motor Coach apologizes for any inconvenience resulting from this campaign but urges you to implement this change as soon as possible.

Sincerely,

Motor Coach Industries



5.1 MCI FIELD CHANGE PROGRAM (FCP) VERIFICATION

CONTACT INFORMATION				
CUSTOMER NAME	:			
(PLEASE PRINT)				
	FCP INFORMATION	ON – ONE FORM PER UNIT		
FCP#:	Coach Model	Model Year		
COACH SERIAL #: (At least the last 5 dig	ite)	DATE COMPLETED//		
MILEAGE:	10)			
IMPORTANT: TO RECEIVE CREDIT FOR ANY ALLOWABLE LABOR CHARGES, THIS VERIFICATION FORM MUST BE RETURNED TO MCI UPON COMPLETION OF THE FCP. SUBMITTED BY: (Please Print)				
		DATE/		
TITLE: (Please Print))			
SIGNATURE:				
COMMENTS:				

FAX TO: 800-360-8886

Mail or fax the completed limited warranty claim form and verification form to MCI's warranty department, or photocopy and mail to:

MCI Fleet Support

Attn: Warranty Department

7001 Universal Coach Drive Louisville, KY 40258

Fax Number 1-800-360-8886

To receive credit for the hours used to complete this task. Contact the MCI Fleet Support Technical Center at 1-800-241-2947 for any further information.