

Classification:

BT20-010

Reference:

ITB20-022

COPYRIGHT© NISSAN NORTH AMERICA, INC.

Date:

September 2, 2020

2016-2017 Q50; RUST ON TRUNK LID ABOVE INNER REAR COMBINATION LAMP

APPLIED VEHICLES: 2016-2017 Q50 (V37)
 2016-2017 Q50 Hybrid (VH37)
APPLIED DATE: Built before April 24, 2017

IF YOU CONFIRM

Client states that corrosion is present on the trunk lid, at or near the rear combination lamps, circled in Figure 1.



Figure 1

ACTION

1. Repair the trunk lid as needed.
2. Add the rubber spacers and the washers, listed in the **PARTS INFORMATION** on page 3, to the rear combination lamps.

IMPORTANT: The purpose of ACTION (above) is to give you a quick idea of the work you will be performing. You **MUST** closely follow the entire **SERVICE PROCEDURE** as it contains information that is essential to successfully completing this repair.

Infiniti Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. **NOTE:** If you believe that a described condition may apply to a particular vehicle, **DO NOT** assume that it does. See your Infiniti retailer to determine if this applies to your vehicle.

SERVICE PROCEDURE

1. Remove the rear combination lamps from the trunk lid.
 - For the procedure to remove the combination lamps, refer to the Electronic Service Manual (ESM): section **DRIVER CONTROLS > EXTERIOR LIGHTING SYSTEM > LED HEADLAMP > REMOVAL AND INSTALLATION > REAR COMBINATION LAMP**.
2. Repair the trunk lid finish as needed.
3. Apply one (1) rubber spacer onto the top of each combination lamp in the area shown in Figure 2.
 - See the **PARTS INFORMATION** on page 3.

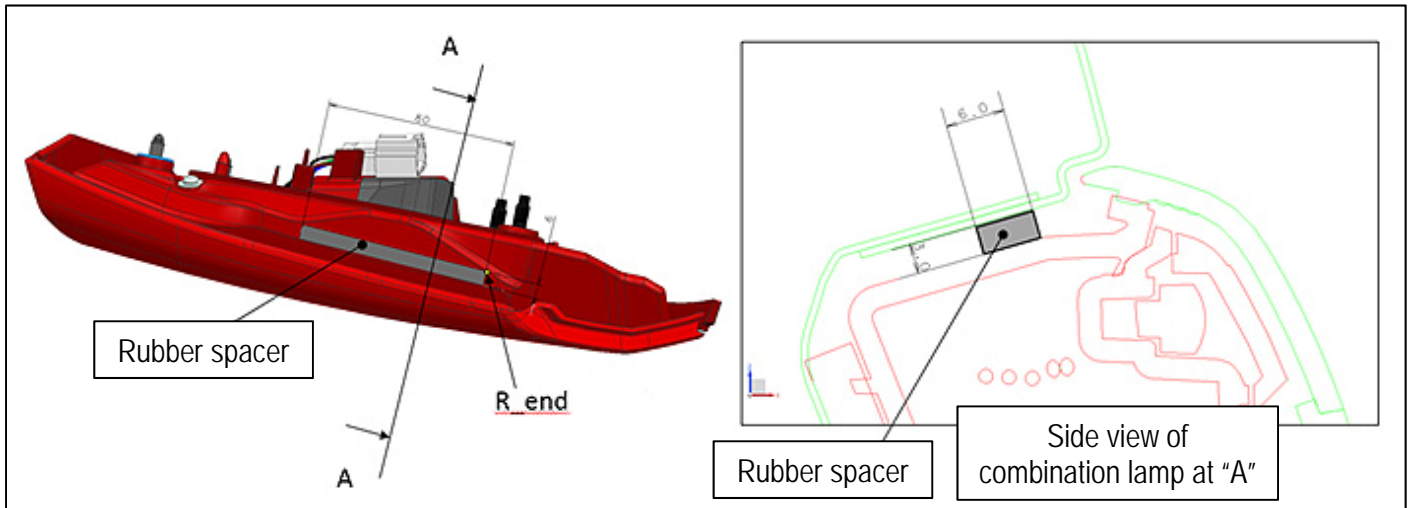


Figure 2

4. Add two (2) washers to each combination lamp; one (1) to each threaded stud where shown in Figure 3.

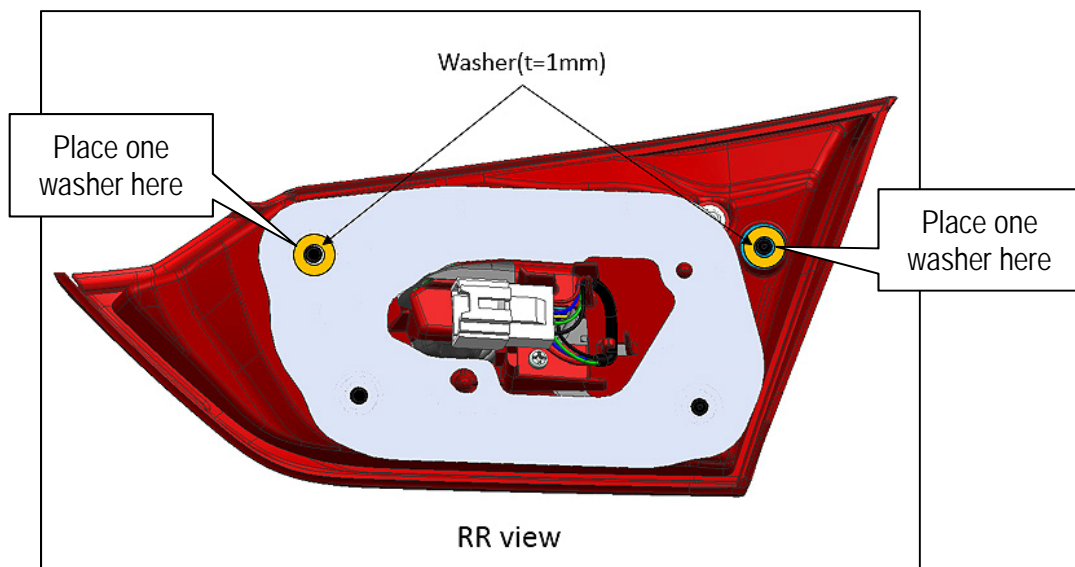


Figure 3

5. Reinstall the rear combination lamps to the trunk lid.
 - For the procedure to reinstall the combination lamps refer, to the Electronic Service Manual (ESM): section **DRIVER CONTROLS > EXTERIOR LIGHTING SYSTEM > LED HEADLAMP > REMOVAL AND INSTALLATION > REAR COMBINATION LAMP.**

PARTS INFORMATION

DESCRIPTION	PART NUMBER	QUANTITY
END RUB-RR COMB LAMP (Rubber Spacer)	26553-4GA0A	2
WASHER-PLAIN	08915-4362A	4

CLAIMS INFORMATION

Submit a Primary Part (PP) type line claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Install Rubber Spacer and Washers	(1)	RX6WAA	ZA	41	0.5

And if needed on the same repair line

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Refinish Trunk Lid-Half Block Repair	(1)	ZL1GAA	ZA	41	(2)
Preparation & Mixing Time		ZZ99AA			

- (1) Reference the electronic parts catalog and use the Combination Lamp Assy (26550-*****) as the Primary Failed Part (PFP).
- (2) Reference the current Infiniti Warranty Flat Rate Manual and use the indicated Flat Rate Time (FRT).

Expense Code

Paint Materials	019
-----------------	-----

AMENDMENT HISTORY

PUBLISHED DATE	REFERENCE	DESCRIPTION
September 2, 2020	ITB20-022	Original bulletin published