

Malfunction of overhead control panel

Topic number	LI82.20-N-071665
Version	1
Function group	82.20 Interior lights
Date	09-03-2020
Validity	Model 907
Reason for change	
Reason for block	

Complaint:

1. Failure or malfunction of overhead control panel OCP
2. Interior sensor of anti-theft alarm system ATA in the OCP is triggered without obvious cause

Cause:

For 1. OCP defective (moisture/water ingress)

For 2. ATA software too sensitive, resulting in triggering of ATA without obvious cause

Remedy:

For 1. Overhead control panel defective (moisture/water ingress)

Note: OCP must not be disassembled

- Check power supply of OCP
- Check contacts of OCP for corrosion.
- If corrosion is present on the contacts, locate and rectify the moisture/water ingress NOTE: Water ingress/moisture caused by outside influence is not warrantable.
- If there is no corrosion present - Do not replace the OCP. Open a PTSS case and wait for feedback

For 2. ATA software too sensitive

- Do not replace parts, observe LI80.50-N-069566

Symptoms
Lighting / Interior illumination / Interior lamp / Flickers
Lighting / Interior illumination / Interior lamp / Does not go on
Lighting / Interior illumination / Interior lamp / Does not go off

Validity

XENTRY TIPS

Vehicle	Engine	Transmission
Sprinter 907	*	*