

STAR ONLINE PUBLICATION

Case Number: S2008000137

Release Date: 9/10/2020

Symptom/Vehicle Issue: Airbag Light Is On Or Power Door Locks Inoperative. DTC's U113D-00, B25AF-2A, B1830-11, B182C-11, And B007F-11 May Be Present.

Discussion: The vehicle body harness may have been pinched at the bottom of the passenger side B-pillar in between the trim retainer and the designated body cut out. The Airbag Light may be on and/or Power Door Locks may be inoperative. Some or all of following DTC's may be present.

U113D-00 Lost Communication With Master Power Window Switch

B25AF-2A Door Lock/Unlock Switch Stuck

B1830-11 All Doors Unlock Control-Circuit Short to Ground

B182C-11 All Door Lock Control-Circuit Short to Ground

B007F-11 Passenger seat belt pretensioner deployment control circuit short to ground


Diagnosis: Inspect the areas below for a possible pinched or damaged harness.

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found

STAR ONLINE PUBLICATION

Passenger B-Pillar Body Cutout Location

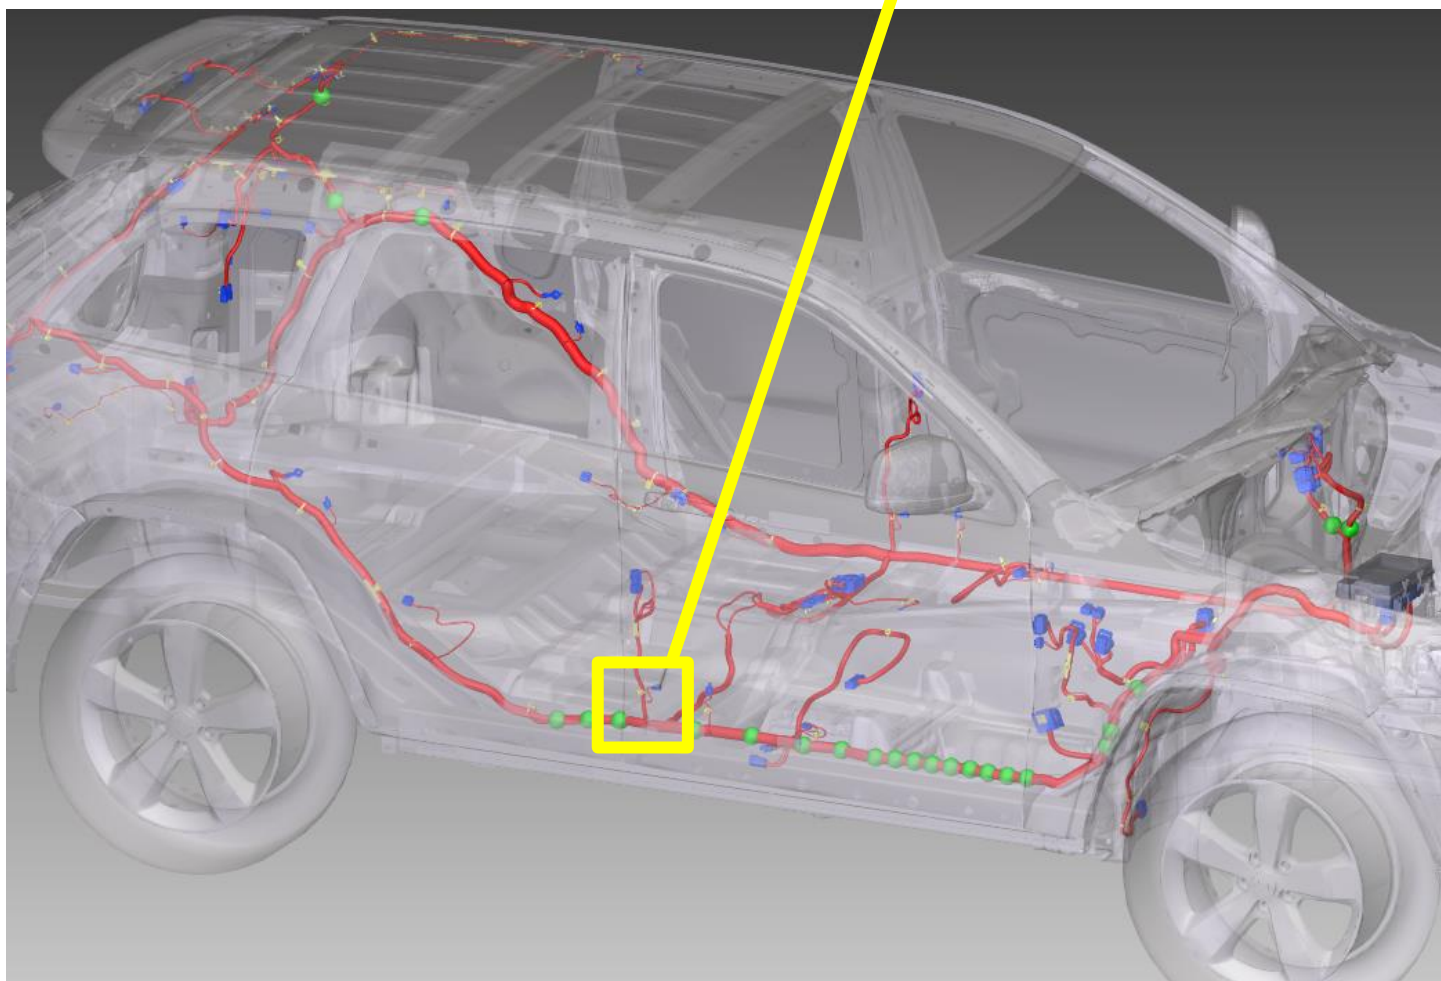


This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found

STAR ONLINE PUBLICATION

Customer Concern: Power door locks are in INOP

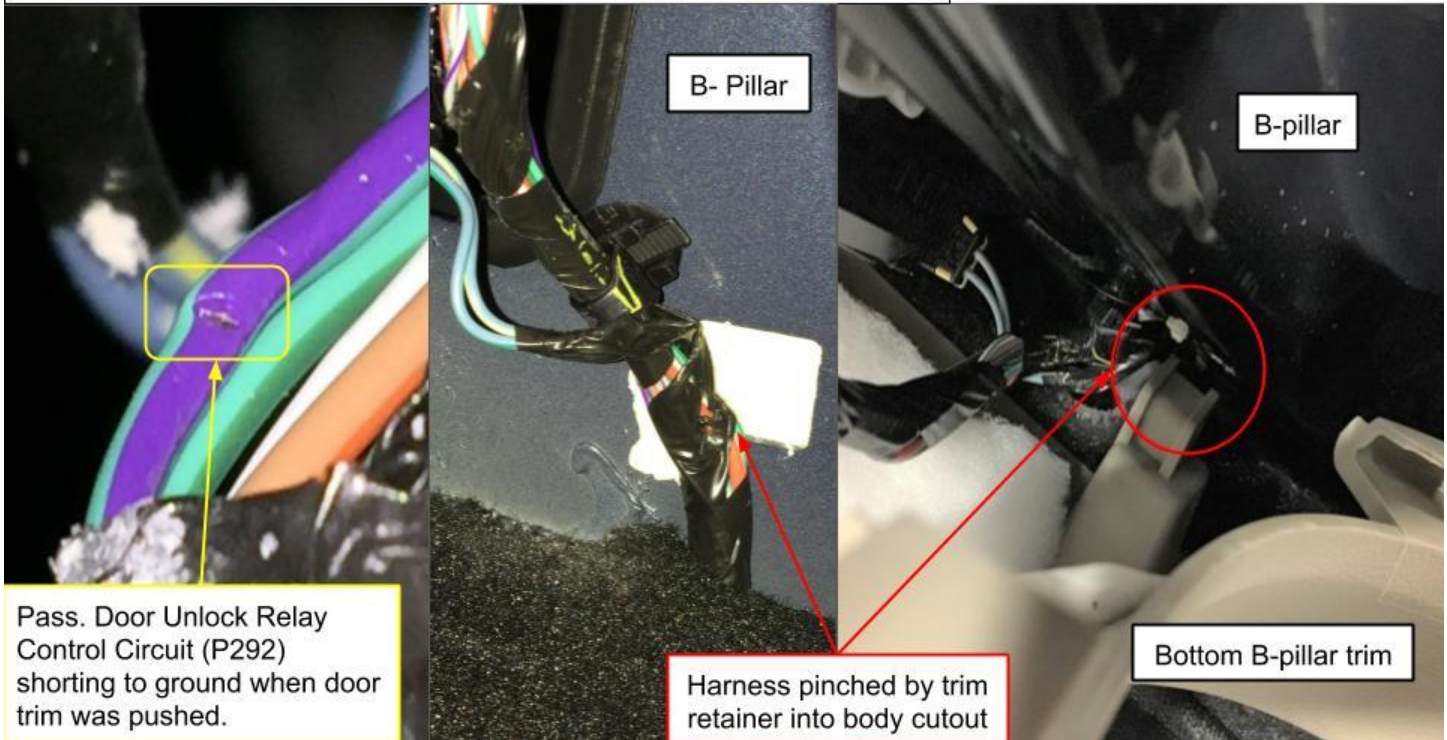


This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found

STAR ONLINE PUBLICATION

Customer concern: Airbag light is on - active B007F-11 passenger seat belt pretensioner deployment control circuit short to ground

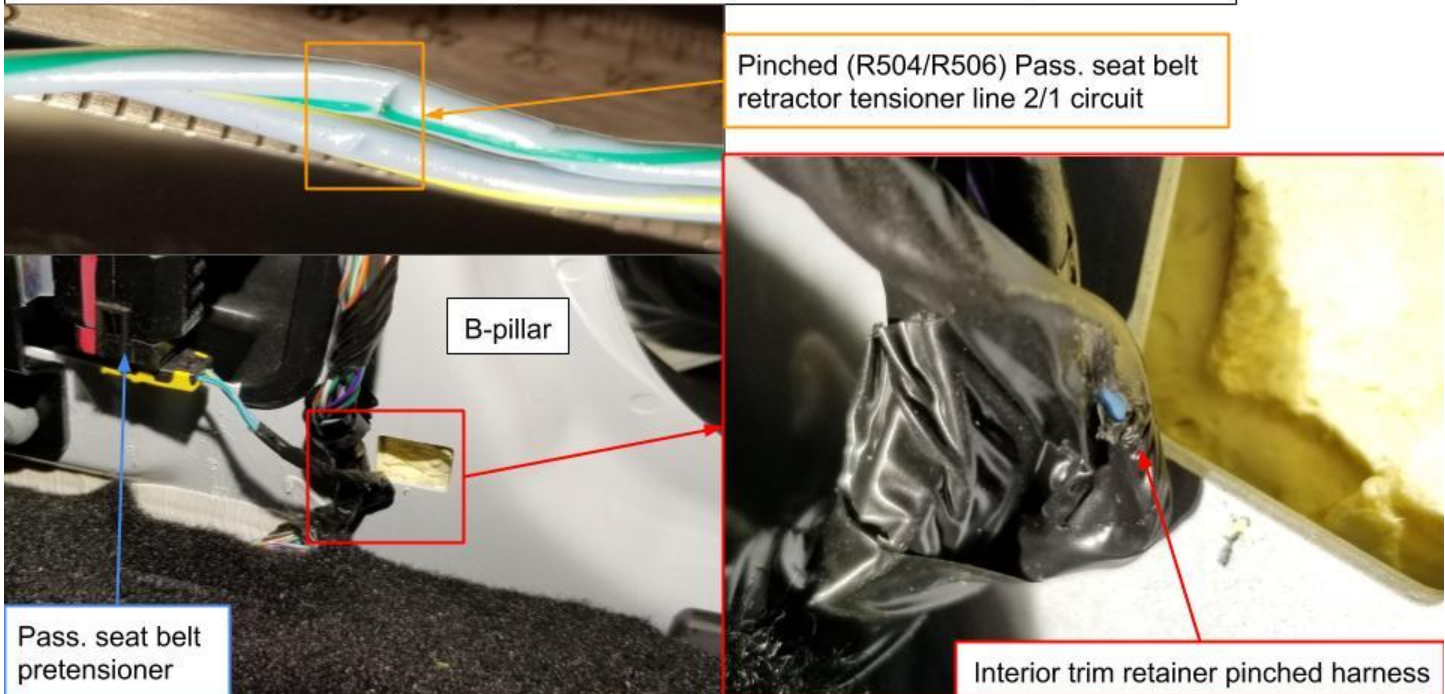

Repair: If possible, repair the wires using standard procedures. If necessary, replace the body harness. Reroute the harness to avoid the body cutout. The application of felt tape around the cutout can be used to further protect the harness.

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found