



Bulletin No.: PIP5752D

Published date: N/A

Preliminary Information

PIP5752D Service Engine Light misfire engine noise With DTC P0300 P0106 P0506

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	Escalade	2021	All	All	6.2 L87	All
Chevrolet	Camaro	2020 - 2021	All	All	6.2 LT1 LT4	All
Chevrolet	Corvette	2020	All	All	6.2 LT2	All
Chevrolet	Silverado	2020	All	All	5.3 L82 L84 6.2 L87 6.6 L8T	All
Chevrolet	Suburban	2021	All	All	5.3 L84 6.2 L87	All
Chevrolet	Tahoe	2021	All	All	5.3 L84 6.2 L87	All
GMC	Sierra	2020	All	All	5.3 L82 L84 6.2 L87 6.6 L8T	All
GMC	Yukon	2021	All	All	5.3 L84 6.2 L87	All

Involved Region or Country	North America
Condition	A Vehicle may have a concern of service engine light, misfire and engine noise with possible of DTC P0300 P0106 P0506.
Cause	Possible broken valve spring.

Note: If you suspect you have a valve spring concern please contact Technical Assistance at (866) 960-6006 (after providing your case number, please select prompt one for engine Drivability then, prompt one for gasoline engines) TAC will assist with issue verification and expediting parts if needed. **In Canada, contact the Canadian Technical Assistance Centre at the number you have been provided.**

Correction:

During inspection if you determine that the engine has a broken valve spring it will be necessary to perform a cylinder leakage test on the affected cylinder.

If no cylinder leakage is observed and the vehicle is built between June 1, 2020 to October 7, 2020:

-For engines with RPOs L82, L84 and L8T replace the affected valve spring, if the vehicle is built between June 1, 2020 to October 7, 2020.

-For 6.2L engines RPOs L87, LT1, LT4 and LT2 It will be necessary to replace all valve springs on both banks if the vehicle is built between June 1, 2020 to October 7, 2020.

If you determine that engine has cylinder leakage it will be necessary to inspect further to determine the extent of the engine damage to determine correct repair required;

-For 6.2L engines RPOs L87, LT1, LT4 and LT2 that has engine damage please follow PIP5759 for engine restriction.

Important: All valve springs will be requested back for further analysis and inspection.

Warranty Information

For vehicles repaired under the Powertrain coverage, use published labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Version History

Version	4
Modified	09/08/2020 - Created on. 09/21/2020 - Updated to add 2020 Chevrolet Camaro and edit the correction statement. 10/13/2020 - Updated Model Years. 10/21/2020 - Updated to add contact Technical assistance



© 2020 General Motors. All Rights Reserved.