PORSCHE'

Symptom-based workshop manual

Service

120/19ENU 1380

Nov 18, 2020

Page 1 of 11

Noise Symptom - Rattling Noises from Engine Compartment: Checking Balance Shaft Bracing Wheel and Replacing it if Necessary (SY 120/19)

Revision:	This bulletin replaces bulletin Group 1 120/19, dated 2/17/2020.
Vehicle Types:	Macan S (95BBH1)/Macan GTS (95BBL1)/Macan Turbo (95BCI1)
Model Year:	As of 2019
Subject:	Balance shaft bracing wheel
Symptom:	Rattling noises from the engine compartment, particularly at an engine speed of between 1,200 and 2,000 rpm (partial load operation, engine at operating temperature).
Remedial Action:	Check balance shaft bracing wheel using a stethoscope and replace it if necessary.
Vehicle Types:	Panamera (971)/Panamera 4 (971)/Panamera 4S (971)/Panamera 4 E-Hybrid (971)/Panamera 4 Sport Turismo (971)/Panamera 4S Sport Turismo (971)/Panamera 4 E-Hybrid Sport Turismo (971)
Model Year:	As of 2017 up to 2019
Subject:	Balance shaft bracing wheel
Symptom:	Rattling noises from the engine compartment, particularly at an engine speed of between 1,200 and 2,000 rpm (partial load operation, engine at operating temperature).
Remedial Action:	Check balance shaft bracing wheel using a stethoscope and replace it if necessary.
Vehicle Types:	Cayenne (9YAAA1)/Cayenne E-Hybrid (9YAAE1)/Cayenne S (9YABB1)/Cayenne Coupé (9YBAA1)/Cayenne E-Hybrid Coupé (9YBAE1)/Cayenne S Coupé (9YBBB1)
Model Year:	As of 2018
Subject:	Balance shaft bracing wheel
Symptom:	Rattling noises from the engine compartment, particularly at an engine speed of between 1,200 and 2,000 rpm (partial load operation, engine at operating temperature).
Remedial Action:	Check balance shaft bracing wheel using a stethoscope and replace it if necessary.

Tools:

Required tools and parts (Macan/ Panamera)

Nr.172 - Stethoscope

Parts Info: 1) Part No. Designation Qty. - Use 9A710344810 \Rightarrow Fastening part 1 ea. - Balance shaft bracing wheel 9A7103293A \Rightarrow Gear wheel 1 ea. - Balance shaft 95810115320 \Rightarrow Shaft sealing ring 1 ea. - Lower chain housing cover N 10156206 \Rightarrow Internal hexagon round cheese head bolt 6 ea. - Lower chain housing cover N 10413405 \Rightarrow Internal hexagon round cheese head bolt 19 ea. - Lower chain housing cover 9A714511320 \Rightarrow Seal 1 ea. - Vacuum pump N 90365302 \Rightarrow 0-ring 1 ea. - Coolant pipe 9A712107000 \Rightarrow Seal 1 ea. - Coolant pipe 9A700565200 \Rightarrow 0-ring 1 ea. - Coolant pipe N 10124306 ⇒ Internal hexagon round/oval-head screw 14 ea. - Upper chain housing cover N 91004802 \Rightarrow Double hexagon-head bolt 2 ea. - Upper chain housing cover N 10451405 \Rightarrow Internal hexagon round/oval-head screw 5 ea. - Fuel high-pressure line 1 ea. 9A710942600 \Rightarrow Axle - Tensioning rail 9A710942610 2 ea. \Rightarrow Axle - Guide rail 95810547000 \Rightarrow Guide rail 2 ea. – Timing chain 9A709493000 \Rightarrow Friction plate 4 ea. - Camshaft actuator 9A710923500 \Rightarrow Sealing ring 4 ea. - Control valves \Rightarrow Internal hexagon round cheese head bolt WHT004955A 1 ea. - Lower steering column universal joint

¹⁾ The parts are only required for replacing the balance shaft bracing wheel.

Required tools and parts (Cayenne)

Tools: •	Nr.172 - Stethoscope
----------	----------------------

Parts Info: ¹⁾	Part No.	Designation – Use	Qty.
	9A710344810	\Rightarrow Fastening part – Balance shaft bracing wheel	1 ea.
	9A7103293A	\Rightarrow Gear wheel – Balance shaft	1 ea.
	95810115320	\Rightarrow Shaft sealing ring – Lower chain housing cover	1 ea.
	N 10156206	\Rightarrow Internal hexagon round cheese head bolt – Lower chain housing cover	6 ea.
	N 10413405	\Rightarrow Internal hexagon round cheese head bolt – Lower chain housing cover	19 ea.
	9A714511320	⇒ Seal – Vacuum pump	1 ea.
	N 90365302	⇒ 0-ring – Coolant pipe	1 ea.
	9A712107000	⇒ Seal – Coolant pipe	1 ea.
	9A700565200	⇒ 0-ring – Coolant pipe	1 ea.
	N 10124306	\Rightarrow Internal hexagon round/oval-head screw – Upper chain housing cover	14 ea.
	N 91004802	\Rightarrow Double hexagon-head bolt – Upper chain housing cover	2 ea.
	N 10451405	\Rightarrow Internal hexagon round/oval-head screw – Fuel high-pressure line	5 ea.
	9A710942600	\Rightarrow Axle – Tensioning rail	1 ea.
	9A710942610	\Rightarrow Axle – Guide rail	2 ea.
	95810547000	\Rightarrow Guide rail – Timing chain	2 ea.
	9A709493000	\Rightarrow Friction plate – Camshaft actuator	4 ea.
	9A710923500	\Rightarrow Sealing ring – Control valves	4 ea.
	N 10518405	\Rightarrow Cheese head bolt with multiple-tooth head – Lower steering column universal joint	1 ea.

¹⁾ The parts are only required for replacing the balance shaft bracing wheel.

Preparatory work

- Work Procedure: 1 Remove engine cover, see \Rightarrow Workshop Manual '108319 Removing and installing engine cover (design cover) (V6 Turbo)'.
 - 2 To remove turbocharger heat shield, see \Rightarrow Workshop Manual '261219 Removing and installing turbocharger heat shield (V6 Turbo)'.

Preparatory work

- Work Procedure: 1 Remove engine cover, see \Rightarrow Workshop Manual '108319 Removing and installing engine cover (design cover) (V6 Turbo)'.
 - 2 To remove air filter housing, see ⇒ Workshop Manual '242519 Removing and installing air filter housing'.

Distinguishing between high-pressure pump and balance shaft bracing wheel



Hot components

- Risk of burns
- \Rightarrow Let hot components cool down.
- \Rightarrow Wear personal protective gear.

i Information

- To prevent unnecessary repairs, it is important to distinguish between the high-pressure pump and balance shaft bracing wheel when trying to pin-point the source of the noise.
- A Nr.172 stethoscope, for example, can be used to pin-point the noise sources.
- If you cannot be sure that the high-pressure pump is causing the noise, the noise analysis
 must be carried out using the stethoscope on the high-pressure pump of a comparable
 vehicle.

Work Procedure: 1 Start the engine.

2 **Nr.172 - Stethoscope** must be used on the high-pressure pump \Rightarrow *Contact point on high-pressure pump* -1 - and then on the engine housing \Rightarrow *Contact point on engine housing* -2 - in order to find the rattling noise.


If you can clearly hear the rattling noise at the contact point on the high-pressure pump \Rightarrow Contact point on high-pressure pump -1-, stop the engine and continue fault finding. Something else is causing the fault.

Symptom-based workshop manual	Service		1
	120/19enu	1380	

If you can clearly hear the rattling noise at the contact point on the engine housing \Rightarrow *Contact point on engine housing* -2-, stop the engine and continue with Step 3.



Contact point on high-pressure pump

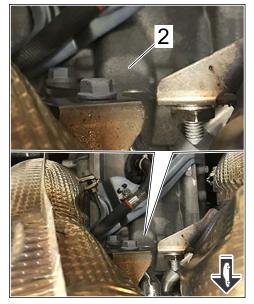

Contact point on engine housing

3 Replace balance shaft bracing wheel, see ⇒ Workshop Manual '138019 Removing and installing balance shaft bracing wheel (V6 Turbo)'.

Concluding work (Macan/ Panamera)

Work Procedure:1 To install the turbocharger heat shield, see \Rightarrow Workshop Manual '261219 Removing and installing turbocharger heat shield (V6 Turbo)'.

2 Install engine cover, see ⇒ Workshop Manual '108319 Removing and installing engine cover (design cover) (V6 Turbo)'.

Concluding work (Cayenne)

Work Procedure: 1 To install air filter housing, see \Rightarrow Workshop Manual '242519 Removing and installing air filter housing'.

2 Install engine cover, see ⇒ Workshop Manual '108319 Removing and installing engine cover (design cover) (V6 Turbo)'.

Invoicing

Invoicing: For documentation and warranty invoicing, enter the labor operations, PQIS coding and part numbers specified below in the warranty claim:

APOS	Labour operation	I No.
13800110	Checking balance shaft bracing wheel	

APOS	Labour operation	I No.
13805510	Checking and replacing balance shaft bracing wheel (vehicles without PCCB)	

APOS	Labour operation	I No.
13805520	Checking and replacing balance shaft bracing wheel (vehicles with PCCB)	

PQIS coding:

Location (FES5)	1380	Drive wheel for balance shaft
Damage type (SA4)	2014	Rattling

Parts: ¹⁾	Part No.	Designation – Use	Qty.
	9A710344810	Fastening part – Balance shaft bracing wheel	1 ea.
	9A7103293A	Gear wheel – Balance shaft	1 ea.
	95810115320	Shaft sealing ring – Lower chain housing cover	1 ea.
	N 10156206	Internal hexagon round cheese head bolt – Lower chain housing cover	6 ea.

Service

120/19_{ENU} 1380

9A714511320	– Lower chain housing cover Seal	1 ea.
	– Vacuum pump	
N 90365302	O-ring	1 ea.
	– Coolant pipe	
9A712107000	Seal	1 ea.
	– Coolant pipe	
9A700565200	O-ring	1 ea.
	– Coolant pipe	
N 10124306	Internal hexagon round/oval-head screw	14 ea.
	 Upper chain housing cover 	
V 91004802	Double hexagon-head bolt	2 ea.
	 Upper chain housing cover 	
N 10451405	Internal hexagon round/oval-head screw	5 ea.
	– Fuel high-pressure line	
9A710942600	Axle	1 ea.
	– Tensioning rail	0
9A710942610	Axle	2 ea.
	– Guide rail	0
95810547000	Guide rail	2 ea.
	– Timing chain	4
9A709493000	Friction plate	4 ea.
24710022500	– Camshaft actuator	1.00
9A710923500	Sealing ring – Control valves	4 ea.
NHT004955A	Internal hexagon round cheese head bolt	1 ea.
WH1004935A	 Lower steering column universal joint 	i ea.
¹⁾ The parts are only	required for replacing the balance shaft bracing whe	el.
	l '108319 Removing and installing engine cover (des	

\Rightarrow Workshop Manual '138019 Removing and installing balance shaft bracing wheel (V6 Turbo)'

Invoicing

References:

Invoicing: For documentation and warranty invoicing, enter the labor operations, PQIS coding and part numbers specified below in the warranty claim:

APOS	Labor operation	I No.
13800110	Checking balance shaft bracing wheel (971)	

Service 1380 ENU120/19

Symptom-based workshop manual

APOS	Labor operation	I No.
13805510	Checking and replacing balance shaft bracing wheel (97AAA1, 97AAY1, 97ABA1, 97ABY1, 97CBA1, 97CBY1)	
	1	

APOS	Labor operation	l No.
13805515	Checking and replacing balance shaft bracing wheel (97ADB1, 97CDB1)	

APOS	Labor operation	I No.
13805520	Checking and replacing balance shaft bracing wheel (97ABE1, 97CBE1)	

PQIS coding:

Location (FES5)	1380	Drive wheel for balance shaft
Damage type (SA4)	2014	Rattling

Parts: ¹⁾	Part No.	Designation – Use	Qty.
	9A710344810	Fastening part – Balance shaft bracing wheel	1 ea.
	9A7103293A	Gear wheel – Balance shaft	1 ea.
	95810115320	Shaft sealing ring – Lower chain housing cover	1 ea.
	N 10156206	Internal hexagon round cheese head bolt – Lower chain housing cover	6 ea.
	N 10413405	Internal hexagon round cheese head bolt – Lower chain housing cover	19 ea.
	9A714511320	Seal – Vacuum pump	1 ea.
	N 90365302	O-ring – Coolant pipe	1 ea.
	9A712107000	Seal – Coolant pipe	1 ea.
	9A700565200	O-ring – Coolant pipe	1 ea.
	N 10124306	Internal hexagon round/oval-head screw – Upper chain housing cover	14 ea.

Symptom-based workshop manual			Service	1
Sympton			120/19 ENU 1380	
	N 91004802	Double hexagon-head bolt – Upper chain housing cover	2 ea.	
	N 10451405	Internal hexagon round/oval-head screw – Fuel high-pressure line	5 ea.	
	9A710942600	Axle – Tensioning rail	1 ea.	
	9A710942610	Axle – Guide rail	2 ea.	
	95810547000	Guide rail – Timing chain	2 ea.	
	9A709493000	Friction plate – Camshaft actuator	4 ea.	
	9A710923500	Sealing ring – Control valves	4 ea.	
	WHT004955A	Internal hexagon round cheese head bolt – Lower steering column universal joint	1 ea.	
	¹⁾ The parts are only	required for replacing the balance shaft bracing	wheel.	
References:	\Rightarrow Workshop Manua	l '108319 Removing and installing engine cover	r (design cover) (V6 Turbo)'	
	\Rightarrow Workshop Manua	al '261219 Removing and installing heat shield fo	or turbocharger (V6 Turbo)'	
	\Rightarrow Workshop Manua	al '138019 Removing and installing balance shat	ft bracing wheel (V6 Turbo)'	

Invoicing

Invoicing: For documentation and warranty invoicing, enter the labor operations, PQIS coding and part numbers specified below in the warranty claim:

APOS	Labor operation	I No.
13800110	Checking balance shaft bracing wheel (9YA/9YB)	

APOS	Labor operation	I No.
13805510	Checking and replacing balance shaft bracing wheel (9YAAA1, 9YBAA1)	

APOS	Labor operation	I No.
13805520	Checking and replacing balance shaft bracing wheel (9YABB1, 9YBBB1)	

Service 1380 ENU 120/19

Symptom-based workshop manual

APOS	Labor operation	I No.
13805515	Checking and replacing balance shaft bracing wheel (9YAAE1, 9YBAE1)	

PQIS coding:

Location (FES5)	1380	Drive wheel for balance shaft
Damage type (SA4)	2014	Rattling

Parts: ¹⁾	Part No.	Designation – Use	Qty.
	9A710344810	Fastening part – Balance shaft bracing wheel	1 ea.
	9A7103293A	Gear wheel – Balance shaft	1 ea.
	95810115320	Shaft sealing ring – Lower chain housing cover	1 ea.
	N 10156206	Internal hexagon round cheese head bolt – Lower chain housing cover	6 ea.
	N 10413405	Internal hexagon round cheese head bolt – Lower chain housing cover	19 ea.
	9A714511320	Seal – Vacuum pump	1 ea.
	N 90365302	O-ring – Coolant pipe	1 ea.
	9A712107000	Seal – Coolant pipe	1 ea.
	9A700565200	O-ring – Coolant pipe	1 ea.
	N 10124306	Internal hexagon round/oval-head screw – Upper chain housing cover	14 ea.
	N 91004802	Double hexagon-head bolt – Upper chain housing cover	2 ea.
	N 10451405	Internal hexagon round/oval-head screw – Fuel high-pressure line	5 ea.
	9A710942600	Axle – Tensioning rail	1 ea.
	9A710942610	Axle – Guide rail	2 ea.
	95810547000	Guide rail – Timing chain	2 ea.
	9A709493000	Friction plate – Camshaft actuator	4 ea.

	9A710923500	Sealing ring – Control valves	4 ea.
	N 10518405	Cheese head bolt with multiple-tooth head – Lower steering column universal joint	1 ea.
	¹⁾ The parts are only required for replacing the balance shaft bracing wheel.		
References:	\Rightarrow Workshop Manual '108319 Removing and installing engine cover (design cover) (V6 Turbe \Rightarrow Workshop Manual '242519 Removing and installing air cleaner housing '		ver) (V6 Turbo)'

⇒ Workshop Manual '138019 Removing and installing balance shaft bracing wheel (V6 Turbo)'

Service

120/19 ENU

1380

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© 2020 Porsche Cars North America, Inc.

AfterSales

Nov 18, 2020 Page 11 of 11