



Preliminary Information

PIT5782A Unable To Program A Replacement Side Object Detection Control Module

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	Escalade Models	2021	All	All	All	All
Cadillac	CT4	2020 - 2021	All	All	All	All
Cadillac	CT5	2020 - 2021	All	All	All	All
Chevrolet	Corvette	2020 - 2021	All	All	All	All
Chevrolet	Suburban	2021	All	All	All	All
Chevrolet	Tahoe	2021	All	All	All	All
GMC	Yukon Models	2021	All	All	All	All

Involved Region or Country	North America
Condition	Some dealerships may comment after replacing only one of the two Side Object Detection Control Modules (B218R or B218L) they are unable to SPS program the new module and it fails programming. When checking for DTC's there may be a U3000 and/or U3007.
Cause	Unknown.

Correction:

Currently, engineering is working on a correction. In the meantime, replacing both Side Object Detection Control Modules (B218R or B218L) at the same time will allow the modules to be SPS programmed.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor time
*6486058	Replace both Side Object Detection Modules and SPS Program	1.3 Hrs.
*This is a unique Labor Operation for Bulletin use only.		

Additional SI Keywords

U0232 U0233 U1602 U1603 U1604 U1605

Version History

Version	2
Modified	09/30/2020 - Created on. 11/19/2020 - Updated the model list



GENERAL MOTORS

© 2020 General Motors. All Rights Reserved.