

JTBO0635NAS2

TECHNICAL BULLETIN

16 DEC 2020



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Jaguar service facility to determine whether this bulletin applies to a specific vehicle.

INFORMATION

This bulletin supersedes TSB JTBO0635NAS1/2018 dated 11 MAY 2018, which should either be destroyed or clearly marked to show it is no longer valid (e.g. with a line across the page). Only refer to the electronic version of this Technical Bulletin in TOPIx.

Changes are highlighted in blue

SECTION:

501-05

SUBJECT/CONCERN:

Luggage Compartment Header Panel Trim

AFFECTED VEHICLE RANGE:

MODEL:	MODEL YEAR:	VIN:	ASSEMBLY PLANT:
XE (X760)	2017	921222-999999	Solihull
XE (X760)	2017-2019	P10168-P46887	Castle Bromwich

MARKETS:NORTH AMERICA

CONDITION SUMMARY:**SITUATION:**

There appears to be a piece of trim missing from the luggage compartment or that the luggage compartment appears unfinished.

CAUSE:

A luggage compartment header panel trim was not originally considered a requirement.

ACTION:

Follow the instructions below.

PARTS:**NOTE:**

* - An allowance of \$5.20 USD or local equivalent has been provided to cover the cost of the double-sided self-adhesive foam. Claim using Sundry Code 'ZZZ001'.

PART NUMBER	DESCRIPTION	QUANTITY
T4N21674	Luggage compartment header trim	1
ZZZ001	Doubled-sided self-adhesive foam	\$5.20 USD or local equivalent

WARRANTY:**NOTE:**

* - An allowance of \$5.20 USD or local equivalent has been provided to cover the cost of the double-sided self-adhesive foam. Claim using Sundry Code 'ZZZ001'.

NOTES:

- Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Use TOPIx to obtain the latest repair time.
- The JLR claims submission system requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Luggage Compartment Header Panel Trim - Installation	76.96.72	0.1	EK	T4N15656

NOTE:

Normal Warranty procedures apply.

NOTES:


- This procedure contains some variation in the illustrations depending on the vehicle specification, but the essential information is always correct.
- This procedure contains illustrations showing certain components removed to provide extra clarity.

1. Open the luggage compartment lid.

2.


NOTE:

Repeat for both sides of the vehicle.

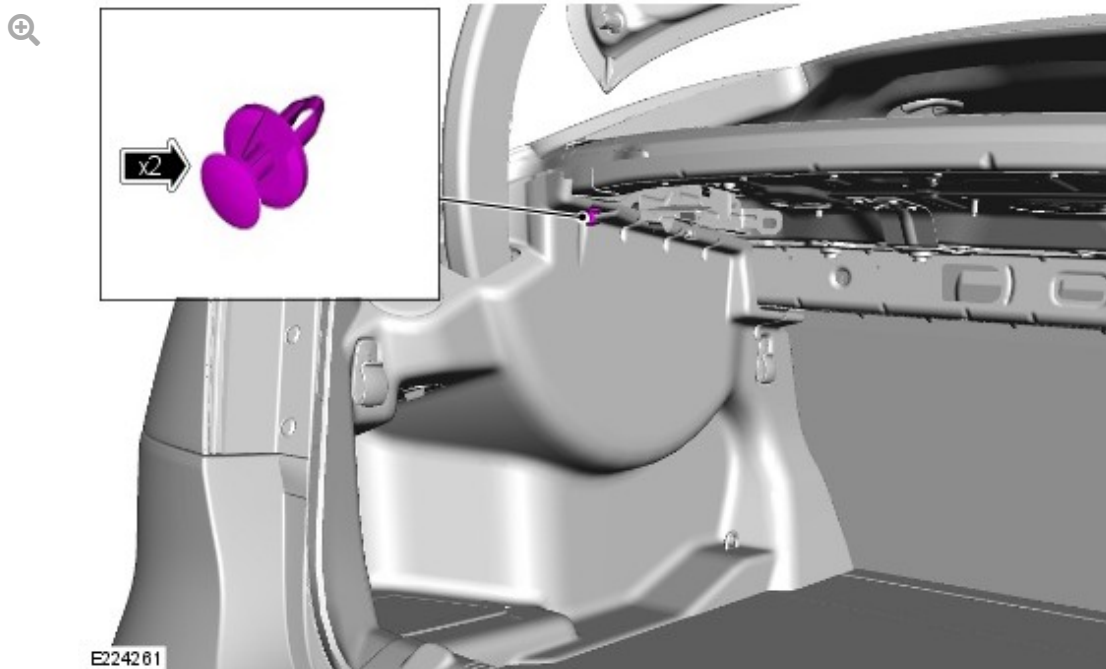


Remove the 2 luggage compartment trim panel retaining clip.

3.

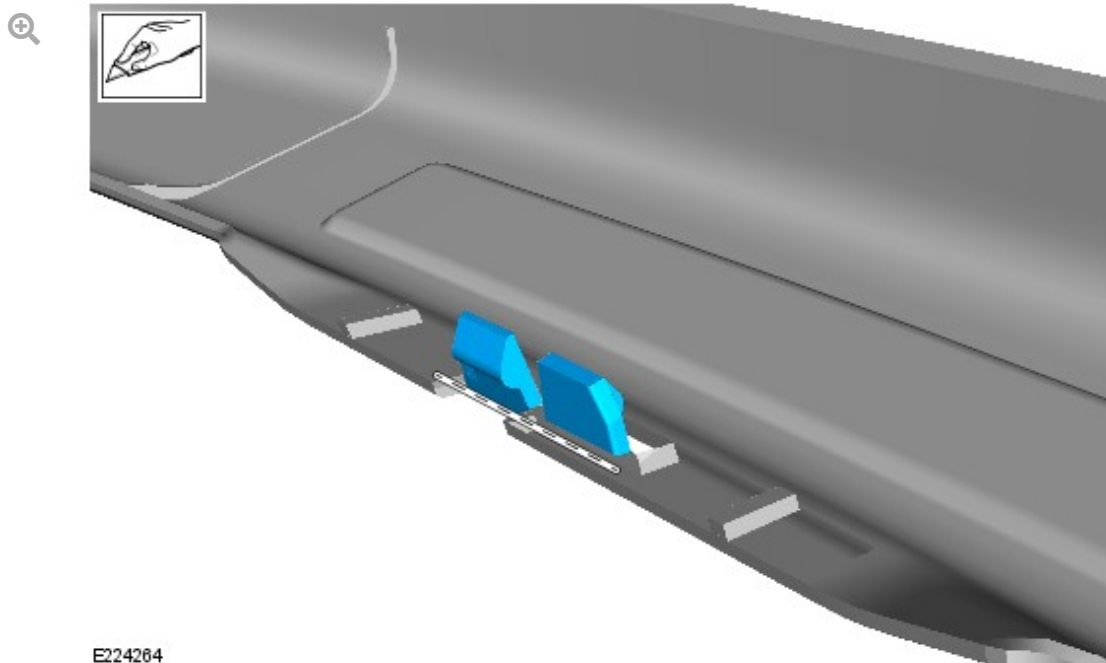

Use a suitable tool to cut the retaining clips from the luggage compartment header panel trim.


4.

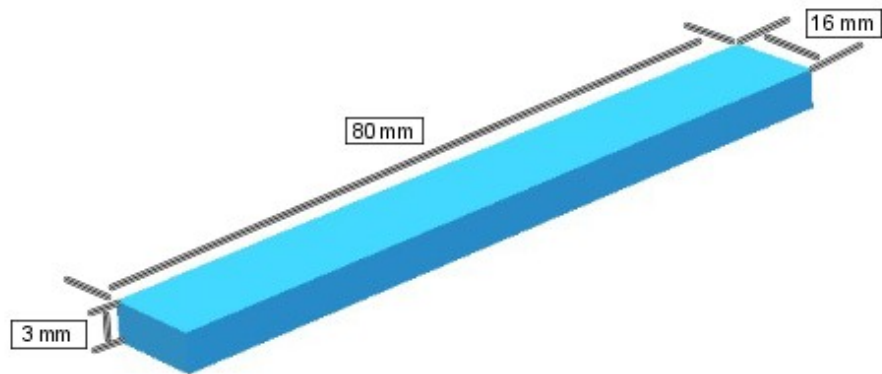

E224282

Measure and cut a suitable piece of double-sided self-adhesive foam to the dimensions shown.


5.

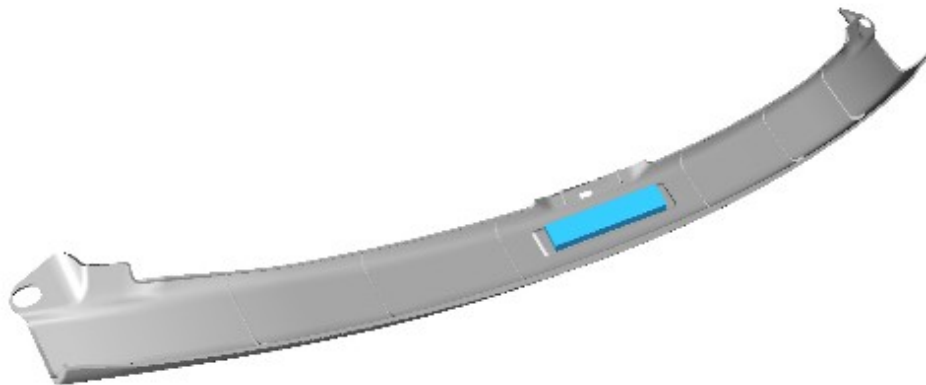

E224283


Install the double-sided self-adhesive foam to the luggage compartment header panel trim.

6.

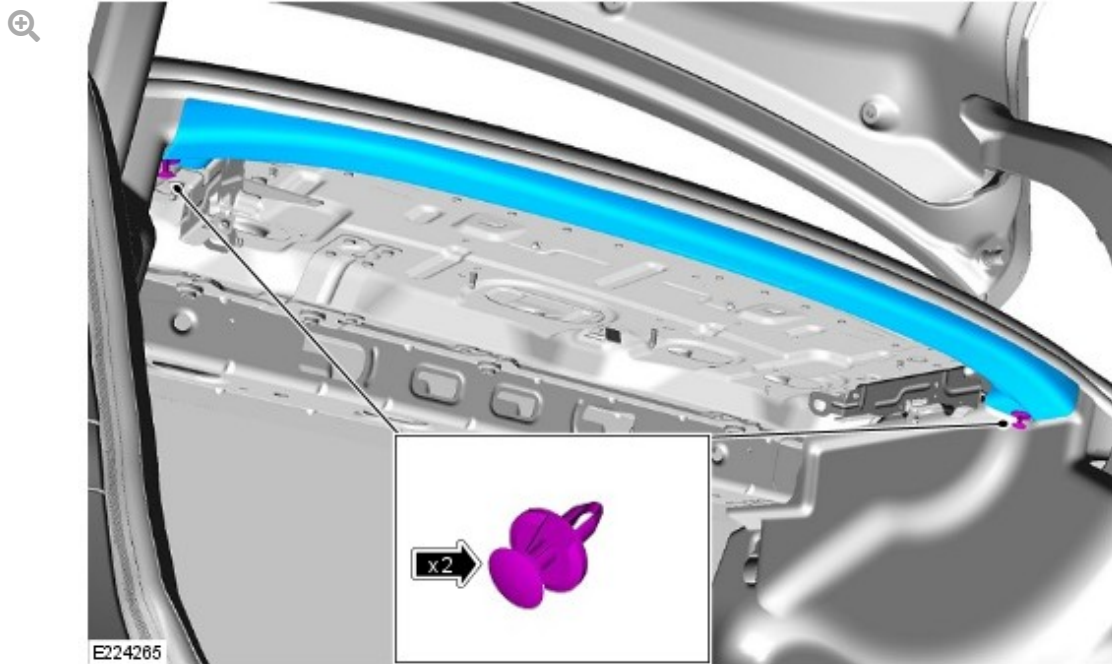


Install the luggage compartment header panel trim.

7.

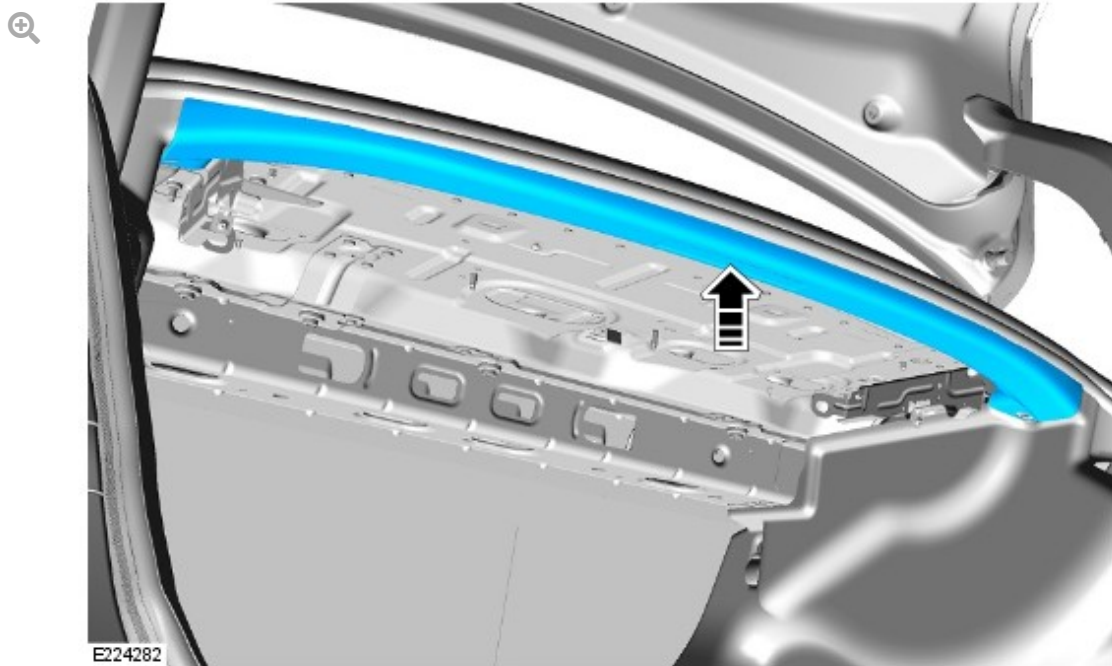

Apply firm pressure to the center of the luggage compartment header panel trim to make sure the self-adhesive foam has bonded.

8.

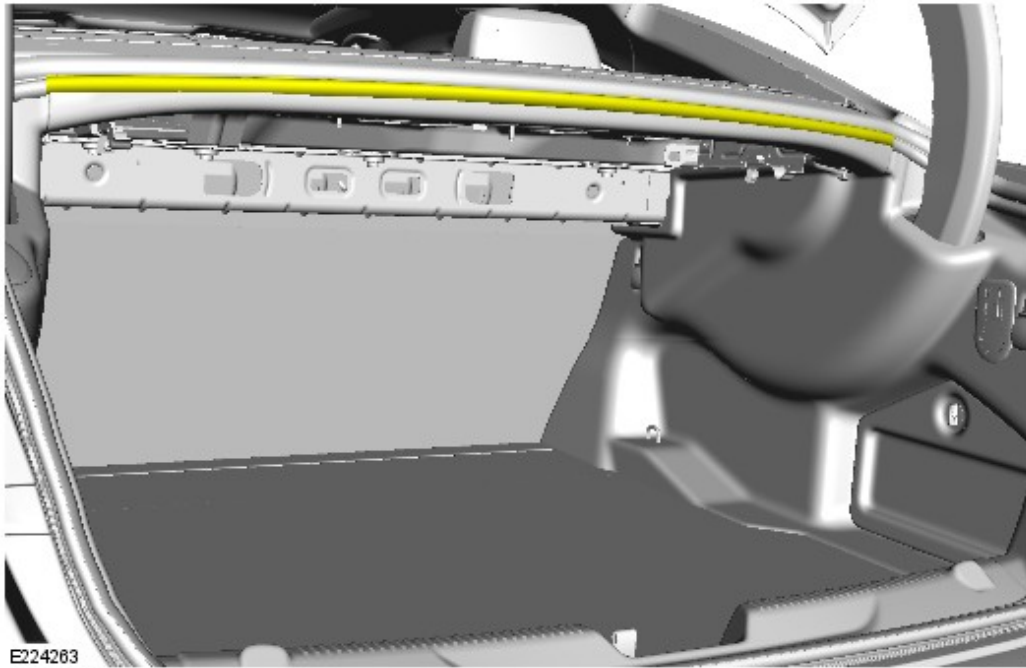

Install the luggage compartment seal over the luggage compartment header panel trim.

9. Close the luggage compartment lid.