

<b>Subject:</b> <b>EXCESSIVE CONDENSATION OR WATER WITHIN THE HEADLAMP ASSEMBLY</b> <b>- CAUTION</b>	<b>Bulletin No:</b> 09-001/17
	<b>Last Issued:</b> 01/13/2017

## BULLETIN NOTE

This bulletin supersedes the previously issued bulletin(s) listed below: The changes are noted in Red beside the change bars.


Previously issued TSBs:	Date issued:	Previously issued TSBs:	Date issued:
09-013/16	02/26/2016	09-003/13	03/04/2013
09-049/14	11/24/2014	09-005/11	02/07/2011

## APPLICABLE MODEL(S)/VINS

2011-2014 Mazda2	2007-2017 Mazda6	2013-2017 CX-5	2007-2011 RX-8
2007-2017 Mazda3	2008-2011 Tribute	2007-2012 CX-7	2006-2017 MX-5
2006-2015 Mazda5	2016-2017 CX-3	2007-2017 CX-9	

## DESCRIPTION

When dealing with customer complaints of excessive condensation and/or water within the headlamp unit, first determine if all the bulb sockets are present and correctly installed. In most cases you will find that the Bulb Seal No. 1 (A) or HID Bulb Seal No. 1 (B) and Bulb Seal No. 2 (C) socket covers have not been correctly installed or are missing due to improper prior repairs (i.e., customer replacing the headlamp bulbs or body shop not transferring them when replacing the headlamp unit(s) due to a collision). Any damage caused by missing socket covers, HID module seal (D), or missing bumper brackets (E) is not covered by warranty policy.

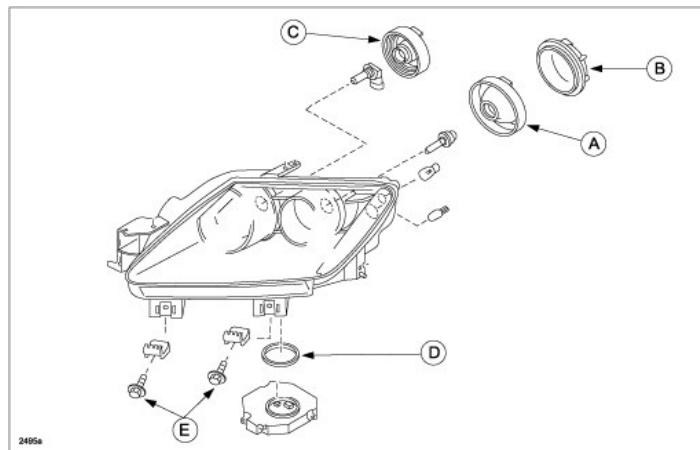

**NOTE:** LED headlamp assembly replacement part include seals. Seal transfer is not required.