

Troubleshooting a Fit with Misfire?

AFFECTED VEHICLES

Year	Model	Trim Level
2015-20	Fit	ALL

If normal troubleshooting suggests replacing the fuel injectors, check the long-term fuel trim using the i-HDS to ensure that it's fixed right the first time.

- If it is less than 1.0% (lean), then it's most likely caused by the injectors.
- If it is more than 1.0% (rich), then it's most likely caused by carbon buildup on the valves. Use a commercially available valve cleaner to resolve the carbon issue.