Advanced Technical Information

Bulletin #: 2100 Part ID: 3734 3

971 - Rough PDK II Operation during Adaption Phase

Vehicles Affected

Models	Model Year	Model Type	VIN Range	Vehicle-Specific Equipment
Panamera	As of 2017 up to 2021	971 (all 97A model variants)	N/A	N/A

Revision History

Revision	Release Date	Changes
0	January 21, 2021	Original document

Condition

Rough gear changes with unmatched engine and transmission revolutions further characterized by:

- Brief engine surges in response without full engagement in the transmission
- Engine temperature approaching or at operating temperature (50 100°C)
- Low vehicle mileage (0 200 miles)
- DME + PDK II programming performed recently, within 200 miles

Technical Background

The aforementioned conditions may result from a transmission that is undergoing adaption. There are numerous pre-requisite operations for successful operations of the PDKII. Examples of such operations include: touch-point adaptions; torque-fill timing, frictional coefficient adaption, control-valve mapping adaptions, and pressure sensor comparison among numerous others. Reprogramming the PDKII necessitates an adaptation.

Therefore, programming should only be conducted when necessary. The following information describes the operating parameters necessary for key adaptions to occur.



Advanced Technical Information

Bulletin #: 2100 Part ID: 3734

Service Information

If it is suspected the PDK II requires adaption, then please observe the following conditions during adaption:

Touch-point adaption and torque-fill timing

- Final Drive Oil Temperature > 45°C and < 110°C
- Operation of the transmission from 4th to 8th gear
- Ideally, driving is to be completed under constant driving conditions by changing gears between engine speeds of 1600 2000 rpm

Frictional Coefficient adaption

- Automatic Transmission Fluid (ATF) Temperature > 65°C and < 95°C
- These adaptions occur with every upshift conducted under load
- Adaptions also occur in Launch Control and the temperature behavior thereof

Control-valve mapping adaptions

- No temperature range limits.
- Occur during every clutch engagement operation

The driving profile most directly determines the driving distance required by the PDK II to adapt successfully. Following the instructions above coupled with varying driving profiles, will allow the PDK II to adapt within approximately 125 miles (200 km). Driving only short trips, by which operating temperatures remain low relative to those referenced above, will significantly increase the distance required for adaption. Furthermore, adaption attempts should occur over longer distances and launches avoided.

Warranty

As always, please document the case completely in PQIS.

For this repair, please code the "cause" as follows:					
Cause location:	37340	"Double clutch transmission"			
Cause symptom:	1126	"Jerky gear change"			

Use the following troubleshooting labor operation:03350000On board diagnostic (Main work) Fault memory read out03350053On board diagnostic (Composite) VAL

Advanced Technical Information

Bulletin #: 2100 Part ID: 3734 3

Search Items

PDK II, Transmission, Clunky, Jerks, Gear change, Adaption

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

