

SSM 49427 - 2019-2020 Edge/Nautilus/Ranger, 2020 Escape, 2020-2021 Corsair/Explorer - 2.0L/2.3L EcoBoost - Lack Of Power With Illuminated MIL - Various DTCs

Some 2019-2020 Edge/Nautilus/Ranger, 2020 Escape and 2020-2021 Corsair/Explorer vehicles equipped with a 2.0L/2.3L EcoBoost may exhibit a lack of power with an illuminated malfunction indicator lamp (MIL) with diagnostic trouble codes (DTCs) P02AB, P0243, P0299, P1464, P25B3, P25B4, P2AB7, P2AB8 and/or P2AB9. This maybe due to a missing wastegate actuator e-clip. A lower level service component has been released, K2GZ-9G488-B for Edge/Nautilus/Escape/Corsair vehicles and LB5Z-9G488-B for Explorer/Ranger vehicles, for service to replace the actuator, actuator rod and both e-clips. Turbocharger replacement is not necessary for missing wastegate actuator e-clips.

APPLICABLE VEHICLES

2020 CAR: TC CX482N ESCAPE
2019 - 2020 CAR: DQ CD539N EDGE
2019 - 2020 CAR: D9 U540N MKX
2019 - 2020 TRUCK: FG P375N RANGER
2020 - 2021 CAR: TF CX483N CORSAIR
2020 - 2021 CAR: TF CX483N CORSAIR
2020 - 2021 CAR: TW U625N EXPLORER