



## STAR ONLINE PUBLICATION



**Case Number:** S2108000023

**Release Date:** 1/22/2021

**Symptom/Vehicle Issue:** Blind Spot Sensor Light Operate Sporadically And Indicates False Detection Without Any DTC

**Discussion:** The customer may experience a blind spot indicator light triggered multiple times in a row without any objects in the blind spot zone. There will be no DTC / warning about the blind spot function being disabled, as the module will not recognize false detections as an issue.

**Diagnosis:** If a DTC exists for the Blind Spot Sensors, perform the DTC diagnostics.

For vehicle without Blind Spot DTC's and sporadic illumination of the Blind Spot light in the mirror. Ensure that the taillights which house the blind spot sensors are cleaned of any dirt or debris. Test drive 2-3 miles without any objects in the blind spot zone and determine if the blind spot indicator light illuminate's multiple times. The Blind Spot Module is dependent on the side of the vehicle that it is located, so false detection events will need to occur on the same side of the vehicle consistently.

**Repair:** If you determine the blind spot indicator illuminates sporadically without any objects in the vehicles blind spots. Replace the Blind Spot Module in the tail lamp. Only replace the BSM on the side of the vehicle that exhibits false detection. Do not replace the Blind Spot Module on both sides of the vehicle unless both sides exhibit the false detection issue.

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

**Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found**