

**WLG9 Workshop campaign - Replacing lower part of front lid lock**

Revision: This bulletin replaces bulletin Group 5 185/20 WLG9, dated January 25, 2021.

Model Year: **As of 2019 up to 2021**

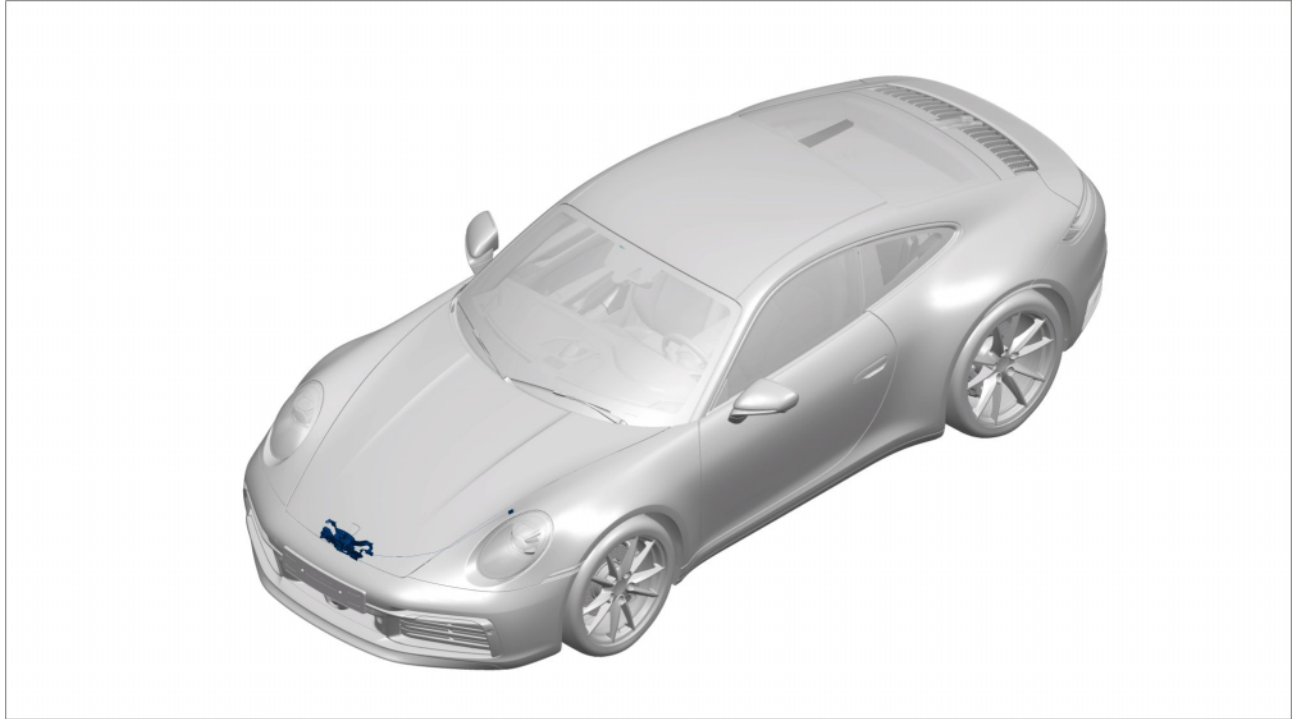
Model Line: **718 Boxster (982)/Cayman (982)  
911 (991)  
911 (992)**

Concerns: **Lower part of front lid lock**

Information: **A bowden cable that does not meet the required specifications was installed on lower part of the front lid lock on the affected vehicles and this can crack over the service life of the vehicle.**  
If this happens, the front lid cannot be unlocked and must then be opened using the emergency release.

Remedial Action: Replace lower part of front lid lock.

Affected Vehicles: Only vehicles assigned to the campaign (see also PCSS Vehicle Information). There are 12,001 vehicles affected by this campaign.

Installation  
Position

*Installation position of lower part of front lid lock*

## Parts required

Parts Info:	Part No.	Designation	Qty.
		- Use	
	V04015004	⇒ Lid lock - 718 Boxster (982)/Cayman (982) - 911 (991)	1 ea.
	V04015004A	⇒ Lid lock - 911 (992)	1 ea.

## Required tools

Tool:	<ul style="list-style-type: none"> <li>Torque wrench, 2-10 Nm (1.5-7.5 ftlb.), e.g. <b>V.A.G 1783 - Torque wrench, 2-10 Nm (1.5-7.5 ftlb.)</b></li> </ul>
-------	---

**Replacing lower part of front lid lock**

Work Procedure: 1 Replace lower part of front lid lock. For instructions, see Workshop Manual for the relevant model line:

- 982: ⇒ *Workshop Manual '551719 Removing and installing lower part of front lid lock'*
- 991: ⇒ *Workshop Manual '551719 Removing and installing lower part of front lid lock'*
- 992: ⇒ *Workshop Manual '551719 Removing and installing front lock lower part'*

2 Enter the campaign in the Warranty and Maintenance booklet.

**Warranty processing**

Scope 1: **Replacing lower part of front lid lock**

- 718 Boxster (982)/Cayman (982)

**Working time:**

Replacing lower part of front lid lock Labor time: **33 TU**  
 Includes: Removing and installing cover on front lock carrier

**Parts required:**

V04015004	Lid lock	1 ea.
-----------	----------	-------

⇒ **Damage Code WLG9 066 000 2**

Scope 2: **Replacing lower part of front lid lock**

- 911 (991)

**Working time:**

Replacing lower part of front lid lock Labor time: **33 TU**  
 Includes: Removing and installing cover on front lock carrier

**Parts required:**

V04015004	Lid lock	1 ea.
-----------	----------	-------

⇒ **Damage Code WLG9 066 000 2**

Scope 3: **Replacing lower part of front lid lock**

- 911 (992)

**Working time:**

Replacing lower part of front lid lock

Labor time: **37 TU**

Includes: Removing and installing cover on front lock carrier

**Parts required:**

V04015004A

Lid lock

1 ea.

⇒ **Damage Code WLG9 066 000 2**

**Important Notice:** Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© 2021 Porsche Cars North America, Inc.