

9002054 06/05/2013 MY03-08 DR, DX

GPOP - Issue Review System

Part Number: 52122362A\$, 52106836A\$, 68036940A\$

Part Description: Pitman Arm

Issue Description: Issue 1: Pitman Arm~

If replacing the steering linkage or drag link inner tie rod assembly at the pitman arm on a vehicle built before February 14 th, 2008, verify that the pitman arm part number is 68039930AA. The part number is embossed on the pitman arm.~

If the pitman arm is not a 68039930AA, it must be replaced with a 68039930AA.~

Issue 2: For 2003 to 2007 MY only. If the OE steering linkage has been replaced with 52122362AA, 52122362AB, 52122362AC, 52122362AD, 52122362AE, or 52122362AF and pitman arm 68039930AA the following service parts are available:~

68038055AA Outer end Tie Rod Package~

68034233AA Tie Rod Adjuster Tube~

68038054AA Inner end Tie Rod Package~

68036726AB Drag Link Outer Socket Package~

68034229AA Drag Link Adjuster Tube~

68036940AA Drag Link Inner Socket Package~

You can go to the 2008 MY for graphical representation of parts.

Issue 3: Some vehicles have been updated with the Big Steering Gear Kit. The Big Steering gear is identified by a 6 bolt top cap and replaces the 4 bolt top cap unit. The Big Steering Gear uses Pitman Arm 68141515AA and DOES NOT use 68039930AA. Ensure Tie Rod alignment procedure is used for proper setup and at vehicle alignment.

~____~
Contact Us at CAGRIS@Chrysler.com for feedback related ONLY to this GPOP Tech Tip. DO NOT email regarding repair procedures unrelated to this Tech Tip or part order inquiries. Please include the Part Number (s) and Tech Tip Part Description of the Tech Tip you are referencing for our tracking system.
