TECHNICAL TOPICS POWERTRAIN





Flashing D After Using Remote Start	18MY - Onward RR, RR Sport PHEV only
Customer Voice: – The vehicle does not engage drive and will show a flashing D only after using remote start.	
 Technical Description: Torque monitoring incorrectly senses a fault due to a timing issue with the change of state from remote engine start to engine running and associated messaging. DTC P061B-62 is stored in the PCM. TOPIx DTC Help Text instructs replacement of the PCM. 	
 Status: Do not replace the PCM for this concern. A revised PCM software is in development and will be released. Normal communication channels of Pathfinder release notes, SFCC, etc. will be utilized to communicate the availability of this update. 	a second
PRINTED COPIES ARE UNCONTROLLED	3