# **TECHNICAL TOPICS POWERTRAIN**





## Check Engine MIL

#### Customer Voice:

The Check Engine MIL is on.


### Technical Description:

DTC P144B-00 is stored in the PCM.

#### Status:

- This DTC can be caused by a blocked or disconnected purge line or by insufficient vacuum generated by the venturi in the intake tube.
- Inspect purge lines for proper routing and ensure the lines are connected.
- Inspect the venturi on the intake tube for any damage or cracks on the exterior mounting of the unit.
- Inspect the internal venturi unit for any damage and proper seating.
- The venturi design has changed for 21MY. If these DTCs are present for 21MY, please also ensure the correct venturi design is installed.
- Internal inspections may require removal of the intake tube and/or inspection with a mirror or borescope.

18MY - Onward Range Rover, RR Sport, RR Evoque, Discovery Sport, F PACE, F TYPE, E XF equipped with AJ20P4 or AJ20P6

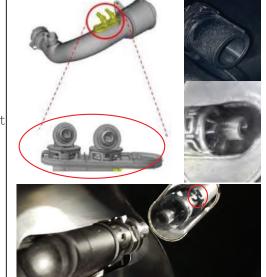











PRINTED COPIES ARE UNCONTROLLED