



Preliminary Information

PIP5787A SES Lamp Illuminated With DTC P00C7 P0106 And P0108 Manifold Absolute Pressure (MAP) Sensor DTCs May Also Be Present

Product Investigation Review Required

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	Escalade	2021	January 1, 2021	February 15, 2021	6.2 L87	All
Chevrolet	Express Van	2021	January 1, 2021	February 15, 2021	6.6L L8T	All
Chevrolet	Silverado New Model	2021	January 1, 2021	February 15, 2021	5.3L (L84) 6.2L (L87)	All
Chevrolet	Silverado HD	2021	January 1, 2021	February 15, 2021	6.6L (L8T)	All
Chevrolet	Suburban	2021	January 1, 2021	February 15, 2021	5.3L (L84) 6.2L (L87)	All
Chevrolet	Tahoe	2021	January 1, 2021	February 15, 2021	5.3L (L84) 6.2L (L87)	All
GMC	Savana Van	2021	January 1, 2021	February 15, 2021	6.6L (L8T)	All
GMC	Sierra New Model	2021	January 1, 2021	February 15, 2021	5.3L (L84) 6.2L (L87)	All
GMC	Sierra HD	2021	January 1, 2021	February 15, 2021	6.6L (L8T)	All
GMC	Yukon	2021	January 1, 2021	February 15, 2021	5.3L (L84) 6.2L (L87)	All

Involved Region or Country	North America
Condition	Some customers may comment that the SES lamp is illuminated or was illuminated and turned off. During inspection Technician may notice DTC P00C7 (Intake Air Pressure Measurement System Sensor and Multiple Sensors Correlation) code active or stored in history. DTC P0106 (Manifold Absolute Pressure Sensor Performance) and P0108 (Manifold Absolute Pressure Sensor Circuit High) may or may not also be present as active or stored in history.
Cause	This condition may be caused by a faulty Manifold Absolute Pressure (MAP) sensor.

Correction:

If you encounter a vehicle with any one of the above DTC's it will be necessary to replace the MAP sensor and reevaluate the vehicle.

If any one of the DTC returns, follow the applicable diagnostic flow chart in service information for further diagnosis and repair.

This PI will be moved to a bulletin after all investigation are complete.

Parts Information

Description	Part Number	Quantity
MAP Sensor	12711681	1

Warranty Information

For vehicles repaired under the Powertrain coverage, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
4025470	Manifold Absolute Pressure Sensor Replacement	Use Published Labor Operation Time
*This is a unique Labor Operation for Bulletin use only.		

Version History

Version	1
Modified	03/16/2021 - Created on. 03/22/2021 - updates to add the Express and Savana



GENERAL MOTORS

© 2021 General Motors. All Rights Reserved.