

Steering wheel heater and/or Distronic function limited

Topic number	LI46.11-P-071594
Version	2
Function group	46.11 - Steering wheel heater
Date	3/19/21
Validity	Model series 167, 177, 205, 247, 253, 293
Reason for change	Updated remedy

Complaint

Steering wheel heater and/or Distronic cannot be activated

Cause

Compatibility between steering wheel control panel and steering wheel electronics

Remedy

Update software for steering wheel electronics control unit ("N 135 - Steering wheel electronics (LRE)").

Should the quick test carried out after the software update still show DTCs with the steering wheel heater and/or Distronic,

replace the steering wheel control panels.

If the steering wheel heater and/or Distronic still fail to actuate after replacing the switch panels, or if there are still DTCs, please create a PTSS case

Symptoms
Chassis/suspension > Steering system > Steering wheel heater > Malfunction
Chassis/suspension > Steering system > Steering wheel heater > Cannot be switched on
Chassis/suspension > Steering system > Steering wheel heater > Insufficient heat output
Communication/information > Assistance and warning systems > Distronic > Function > Malfunction
Communication/information > Assistance and warning systems > Distronic > Display message > Function error

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note
			46342**	Compatibility of steering wheel electronics
			46237**	Steering wheel switch group compatibility