

Active Engine Mount Faults In Quick Test - Model Series 290, Model Series 205 Facelift, Model Aeries 253 Facelift, Model Series 167

Topic number	LI22.10-P-071055
Version	2
Function group	54.00 - General
Date	3/10/21
Validity	290.688 / 689 205 AMG Facelift 167 AMG253 AMG
Reason for change	Validity expanded, remedy revised

Complaint

- In the quick test, faults P0A1402 and/or P0AB602 are stored in the Drive Unit, electrical fault or open circuit (signal error) in actuation system

- Vibrations or jolting from area of drivetrain when starting off and in low speed ranges (model series 290 only)

Cause

Faulty acceleration sensor(s) for active engine mounts

Remedy

Replace both acceleration sensors for the engine mounts

Check software for active engine mounts and apply any updates, if available.

Symptoms

Power generation > Engine management > Function > Malfunction

Operation numbers/damage codes

Op. no.	Operation text	Time	Damage code	Note
---------	----------------	------	-------------	------