

9001784

06/04/2014

MY03-08

DR, DX, HB, KK, ND, WK, XK, KA, KJ, AN

## **GPOP - Issue Review System**

**Part Number:** R2637078A\$, 05174604A\$, 05103475A\$, 05069216A\$

**Part Description:** Short/Long Block Assembly

**Issue Description:** When ordering a 3.7L short block assembly for use in an automatic transmission application: Please be aware that most 3.7L applications that use the 42RLE transmission require a "pilot sleeve" for the back of the crankshaft to support the torque converter pilot hub properly and prevent undesirable powertrain vibrations. The pilot sleeve for 3.7L 42RLE equipped applications is: 04736483AA. If vehicle is equipped with a 45RFE transmission (2004 and earlier) the pilot sleeve must be removed or damage to the cylinder block and transmission will occur.~

~\_\_\_\_~  
Contact Us at [CAGRIS@Chrysler.com](mailto:CAGRIS@Chrysler.com) for feedback related ONLY to this GPOP Tech Tip. DO NOT email regarding repair procedures unrelated to this Tech Tip or part order inquiries. Please include the Part Number (s) and Tech Tip Part Description of the Tech Tip you are referencing for our tracking system.