

TECHNICAL TOPICS POWERTRAIN



<p>Flashing D After Using Remote Start</p>	<p>18MY - Onward RR, RR Sport PHEV only</p>
<p><u>Customer Voice:</u></p> <ul style="list-style-type: none"> - The vehicle does not engage drive and will show a flashing D only after using remote start. <p><u>Technical Description:</u></p> <ul style="list-style-type: none"> - Torque monitoring incorrectly senses a fault due to a timing issue with the change of state from remote engine start to engine running and associated messaging. - DTC P061B-62 is stored in the PCM. TOPIx DTC Help Text instructs replacement of the PCM. <p><u>Status:</u></p> <ul style="list-style-type: none"> - Do not replace the PCM for this concern. - A revised PCM software has been released for this concern. - Reference SSM 75298. <div data-bbox="711 283 1156 619" data-label="Image"> </div>	

