



# SERVICE BULLETIN

Classification: EL13-056	Reference: NTB14-073	Date: July 31, 2014
-----------------------------	-------------------------	------------------------

## PATHFINDER; AUTOMATIC DRIVE POSITIONER LOSES MEMORY

**APPLIED VEHICLE:** 2013 - 2014 Pathfinder (R52)

**APPLIED VINs and**

**DATES:** Vehicles built before 5N1AR2M(\* \*)EC 681098 and March 13, 2014

**NOTE:** This bulletin does not apply to Pathfinder Hybrid.

### IF YOU CONFIRM:

With the ignition turned ON, the following Automatic Drive Positioner (ADP) related items operate as stated below:

- The driver's seat, outside mirrors, and steering wheel will not adjust to preset positions.
- Memory positions 1 and 2 do not work when their buttons are pressed.
- The LED memory position and set indicator light does not come on.
- The outside mirrors can NOT be adjusted with the power mirror switch.
- The driver's seat and steering wheel can be adjusted with the steering wheel switch.

### ACTION:

Replace the BCM.

- For BCM replacement procedure, refer to the **M ELECTRICAL & POWER CONTROL > BCS Body Control System** section of the appropriate Electronic Service Manual (ESM).

### PARTS INFORMATION

DESCRIPTION	PART NUMBER	QUANTITY
CONTROLLER ASSY - BCM	284B1-9NA1B	1

### CLAIMS INFORMATION

Submit a Primary Part (PP) type line claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
BCM-Replace	(1)	RX3UAA	ZE	32	1.0
BCM- Configuration		RX3U1A			0.2

(1) Refer to the electronic parts catalog (FAST) and use the BCM (284B1-XXXXX) as the primary failed part (PFP).

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.