

NISSAN BULLETIN Hood Primary Latch Dealer Service Action

Reference: PC419

Date: December 16, 2015

Attention: Dealer Principal, Sales, Service & Parts Managers

Affected Models/Years:	Affected Population:	Dealer Inventory:	SERVICE COMM Activation date:	
MY2016 Maxima (A36)	NA NA	9,025	December 16, 2015	
MY2015 Murano (Z52)		9,863		
MY2015-16 Pathfinder (R52)		9,247		
MY2015-16 Rogue (T32)		13,791		

*****Dealer Announcement****

Nissan is conducting a dealer inventory service action to inspect and, if necessary, replace the hood latch on certain MY 2015 Murano, MY2016 Maxima, and MY2015-16 Rogue and Pathfinder vehicles currently in dealer inventory or assigned and in transit to check for possible out-of-specification primary hood latch sub-component.

IMPORTANT: Dealers should not sell or trade any affected vehicles in dealer inventory subject to this service action until the hood latch has been inspected and proper operation has been confirmed.

*****What Dealers Should Do*****

PLEASE FOLLOW THE ATTACHED REPAIR INSTRUCTIONS:

- 1. Verify if vehicles currently in dealer inventory are affected by this inventory inspection using Service Comm **I.D. PC419.**
- 2. Use the attached procedure to inspect and, if necessary, repair the vehicle.
- 3. The service department should immediately submit a warranty claim so that the results of this inspection can be tracked, and then release the vehicle for sale.

***** Dealer Responsibility *****

It is the dealer's responsibility to check Service Comm using the appropriate campaign I.D for the inspection status on each affected vehicle currently in inventory. Nissan requests dealers to perform this repair on vehicles in inventory prior to being retailed to ensure customer satisfaction.

NISSAN NORTH AMERICA, INC.

Aftersales DIVISION

PC419 – Rogue, Pathfinder, Murano, Maxima Hood Latch SERVICE PROCEDURE

- 1. Open the hood for inspection.
- 2. Inspect the black hood latch spring position (Figure 1):
 - If the hood latch spring is in the proper position, shown in Figure 2, continue to step 3.
 - If the hood latch spring is out of position, as shown in Figure 1, replace hood latch per the Electronic Service Manual (ESM).

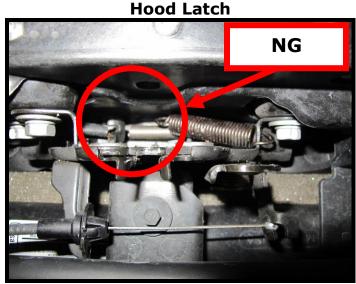


Figure 1

- 3. Open and close the hood 30 times.
 - Pull release lever
 - Open hood
 - Close hood fully
 - Repeat 30 times
- 4. After cycling the hood inspect the black hood spring position:
 - If the spring is still in place (Figure 2) the inspection is complete.
 - If the spring has dislodged (Figure 1), replace the hood latch assembly per the ESM.

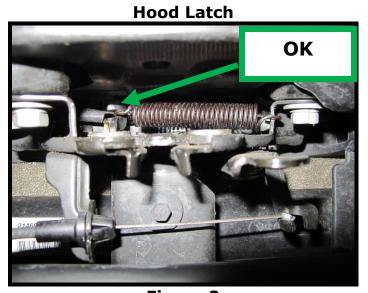


Figure 2

CLAIMS INFORMATION

Submit claim using the following claims coding:

Work Order Line Type: "CM" Campaign

Campaign: PC419

Claim Type:	CM			
PNC:	PC419			
Symptom:	ZZ 99			
Diagnosis:				
Description:	Op Codes	Flat Rate Time	Parts Required on claim	Expense Code Required
Inspect Hood Latch Assembly	PC4190	0.4 hrs.	No	No
Inspect and Replace Hood Latch Assembly (Maxima A36)	PC4191	1.5 hrs.	YES	No
Inspect and Replace Hood Latch Assembly (Rogue T32, Murano Z52)	PC4192	0.6 hrs.	YES	No
Inspect and Replace Hood Latch Assembly (Pathfinder R52)	PC4193	0.7 hrs.	YES	No