



Bulletin No.: PIT5717A
Published date: 04/26/2021

Preliminary Information

PIT5717A Sunroof, Rear Sliding Window, And/Or Wireless Charging Inoperative - Fuse F2DL And/Or F8DL Open

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	Escalade	2015 - 2020	All	All	All	All
Chevrolet	Silverado	2016 - 2018	All	All	All	All
Chevrolet	Silverado LD	2019	All	All	All	All
Chevrolet	Silverado 2500/3500	2019	All	All	All	All
Chevrolet	Suburban	2015 - 2020	All	All	All	All
Chevrolet	Tahoe	2015 - 2020	All	All	All	All
GMC	Sierra	2016 - 2018	All	All	All	All
GMC	Sierra Limited	2019	All	All	All	All
GMC	Sierra 2500/3500	2019	All	All	All	All
GMC	Yukon Models	2015 - 2020	All	All	All	All

Involved Region or Country	North America
Condition	Some customers may comment the sunroof, rear sliding window, and/or the wireless charging mat may be inoperative. Technicians may find the F2DL or F8DL open.
Cause	Harness chaffing at the hinge area of the center console.

Correction:

Inspect the center console harness at any part of the hinge area for chaffing. See example below.



If any harness damage is found, repair as necessary.

Warranty Information

For wiring repairs covered under warranty, please refer to the latest version of bulletin [10-00-89-005](#) for warranty information on wire/connector repairs.

Version History

Version	2
Modified	10/28/2019 - Created on. 04/26/2021 - Updated Warranty Information.



GENERAL MOTORS

© 2021 General Motors. All Rights Reserved.