Technical product information

Торіс	Driver/Passenger door/s power latch creak on close				
area	India (5IN),Kenia (5KE),Russische Föderation (5RU),Südafrika (5ZA),Australia E04 Bentley rest Asia and Australia (6E04),China 796 VW Import Comp. Ltd (Vico), Beijing (6796),Germany E02 Bentley rest Europe (6E02),Japan E03 Bentley Japan (6E03),Korea, (South) E08 Bentley South Korea (6E08),United Kingdom E01 Bentley UK (6E01),United States E05 Bentley USA and rest America (6E05)				
Brand	Bentley				
Transaction No.	2061582/3				
Level	EH				
Status	Approval				
Release date					

New customer code

Object of complaint	Complaint type	Position
body fixtures and fittings -> doors	noise, vibration	
body fixtures and fittings -> door, closures operation	functionality	
body fixtures and fittings -> door, closures operation -> close door	noise, vibration -> noise	

New workshop code

Object of complaint	Complaint type	Position
body fixtures and fittings -> doors -> door power-latching motor	noise, vibration -> noise	right
body fixtures and fittings -> doors -> door power-latching motor	noise, vibration -> noise	left

Vehicle data

Bentayga

Sales types

Туре	MY	Brand	Designation	Engine code	Gearbox code	Final drive code
4V1*	2021	E		*	*	*

Documents

Document name

master.xml

Customer statement / workshop findings

Driver or Passenger door creak during the power latch "Close" function

Technical background

VERY IMPORTANT: Refer to the vehicle repair history to check and confirm any previous work done regarding power latch drive unit replacement noting the following:

- Upon first complaint of a power door latch creaking Replace all four power door latches
- For any complaints of the same symptom that occur after this Only replace the power door latch which is exhibiting the symptom
- · Figure 1 shows and example of the power latch drive unit



Figure

Production change

Please note the manufacturer cut off dates for good parts are as follows:

- Front power door latch 10 Oct. 2020 [10/10/2020]
- Rear power door 02 Oct. 2020 [02/10/2020]

Measure

Ensure the fault is as described within the Customer statement, refer to the video on the Bentley Hub referencing TPI 2052394/-

NOTE: The video shown on the Bentley Hub is for reference purposes only, the symptom is the same regardless of vehicle type shown

1) Obtain video's clearly showing the date of manufacture or take a photograph of the manufacture date of each applicable power latch motor, the operative MUST save each video and picture as they will be required later within this procedure

VERY IMPORTANT: Refer to the vehicle repair history to check and confirm any previous work done regarding power latch drive unit replacement noting the following:

- · Upon first complaint of a power door latch creaking Replace all four power door latches
- For any complaints of the same symptom that occur after this Only replace the power door latch which is exhibiting the symptom

2) Referring to the applicable Repair Group - Rep.Gr 57 (Front) or Rep.Gr 58 (Rear) - Replace one or all four door latches (as detailed in the Technical background section)

- Right hand front
- Left handfront
- Right hand rear
- Left handrear

3) Open a Non technical/For information only DISS query

- · Attach the applicable videos to the open DISS query
- Submitthe DISSquery

Warranty accounting instructions

WarrantyType 110 or 910

Damage Service Number57 17Damage Code00 20Time to replace x4 doorlatchesLabour57 17 56 00Time to replace x1 doorlatchesLabourLabourLabour57 17 1900Labouroperation code57 17 1900Time40 Time units

Parts information

Refer to the ETKA parts catalogue