T-SB-0028-21 May 11, 2021



ABS Brake Warning Light On

Service

Category Brake

Section Brake Control/Dynamic Control System

Market USA



Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION
2012 - 2014	Prius C	

Introduction

Some 2012 – 2014 model year Prius C hybrid vehicles may exhibit a condition in which the brake, ABS, and/or TRAC warning lights are on and/or a Check VSC message displays. Diagnostic Trouble Codes (DTCs) C1391, C1252, C1256, and/or C1253 may also be stored. This condition may be caused by a small internal brake fluid leak inside the brake booster assembly with master cylinder. Follow the Repair Procedure in this bulletin to address this condition.

Warranty Information

MODEL YEAR	MODEL	OP CODE	DESCRIPTION	TIME	OFP	T1	T2
2012 – 2014	Prius C	BR1922	R & R Brake Booster Assembly With Master Cylinder and Brake Booster Pump Assembly	2.3	47050-#####*	8C	99

^{*}Warranty claim MUST be submitted with the correct 10-digit OFP. Choose the correct OFP for the vehicle being repaired by searching for the parts in the Electronic Parts Catalog using the VIN filter.

APPLICABLE WARRANTY

- This repair is covered under the Toyota Basic Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to occurrence of the specified condition described in this bulletin.

TOYOTA T-SB-0028-21 May 11, 2021 Page 2 of 3

ABS Brake Warning Light On

Parts Information

MODEL YEAR MODEL	PART NUMBER		DARTMANE		
	MODEL	PREVIOUS	NEW	PART NAME	QTY
2012 2012		47050-52020	04000-23152	Culinder Kit. Breke Meeter W/Fluid	
2012 – 2013		47050-52040	04000-23252		
2013 – 2014 Prius C	Prius C	47050-52220	04000-23352	Cylinder Kit, Brake Master W/Fluid	1
		47050-52240	04000-23452		
2012 – 2014		47070-52020	04006-74152	Pump Assy Kit, Brake Booster	

Required Tools & Equipment

REQUIRED EQUIPMENT	SUPPLIER	PART NUMBER	QTY	
Techstream ADVI*		TSADVUNIT		
Techstream 2.0	ADE	TS2UNIT	1	
Techstream Lite	ADE	TSLITEPDLR01	'	
Techstream Lite (Green Cable)		TSLP2DLR01		

^{*}Essential SST.

NOTE

- Only ONE of the Techstream units listed above is required.
- Software version 16.00.021 or later is required.
- Additional Techstream units may be ordered by calling Approved Dealer Equipment (ADE) at 1-800-368-6787.

TOYOTA T-SB-0028-21 May 11, 2021 Page 3 of 3

ABS Brake Warning Light On

Repair Procedure

Confirm the condition exists.

Are the brake, ABS, and/or TRAC warning lights on and/or does a Check VSC message display?

- YES Continue to step 2.
- NO This bulletin does NOT apply. Continue diagnosis using the applicable Repair Manual.
- 2. Using Techstream, check for and record ANY stored DTCs.

Are ANY of the following DTCs stored: C1391, C1252, C1256, or C1253?

- YES Continue to step 3.
- NO This bulletin does NOT apply. Continue diagnosis using the applicable Repair Manual.
- 3. Remove the brake booster assembly with master cylinder.

Refer to TIS, applicable model and model year Repair Manual:

- 2012 / 2013 / 2014 Prius C: Brake – Brake System – "Brake System (Other): Brake Booster: Removal"
- 4. Remove the brake booster pump assembly.

Refer to TIS, applicable model and model year Repair Manual:

- 2012 / 2013 / 2014 Prius C: Brake – Brake System – "Brake System (Other): Brake Booster Pump: Removal"
- 5. Install the NEW brake booster assembly with master cylinder.

Refer to TIS, applicable model and model year Repair Manual:

- 2012 / 2013 / 2014 Prius C: Brake – Brake System – "Brake System (Other): Brake Booster: Installation"
- 6. Install the NEW brake booster pump assembly.

Refer to TIS, applicable model and model year Repair Manual:

- 2012 / 2013 / 2014 Prius C: Brake – Brake System – "Brake System (Other): Brake Booster Pump: Installation"
- 7. Using Techstream, clear ANY stored DTCs and test-drive the vehicle to confirm the condition is no longer present.