



# Technical Service Bulletin

## 90 Instrument cluster driver information system display is blank

90 21 11 2063913/2 July 26, 2021. Supersedes Technical Service Bulletin Group 90 number 21-09 dated June 30, 2021 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A4, A4 allroad, S4, A5, A5 Cabriolet, A5 Sportback, S5, S5 Cabriolet, S5 Sportback, RS5, RS5 Cabriolet, RS5 Sportback, A6, A6 allroad, A6 Avant, S6, RS6 Avant, A7, S7, RS7, A8, S8, Q5, SQ5, Q7, SQ7, Q8, SQ8, and RS Q8	2021	All	MIB3

## Condition

REVISION HISTORY		
Revision	Date	Purpose
2	-	Revised header (Corrected Elsa display issue)
1	06/30/2021	Initial publication

### Customer states:

- The driver information system in the instrument cluster (PR Code 9S7) is blank.
- The speedometer, tachometer and bar graphs showing the fuel level and coolant temperature work normally (Figure 1).



# Technical Service Bulletin

---



**Figure 1.** Instrument cluster display is blank.

## Technical Background

There is a hardware defect in the instrument cluster.

## Production Solution

An optimized instrument cluster hardware has been introduced in series production.

## Service

### SVM Update Instructions

1. Follow all instructions in TSB 2011732: *00 Software Version Management (SVM), operating instructions*.
2. Update the instrument cluster, J285 (address word 0017) using the SVM action code as listed in the table below, if necessary:



# Technical Service Bulletin

Model	Old Software Part Number	Old Software Version	New Software Part Number (or higher)	New Software Version (or higher)	SVM Code Input
A4/A5	8W5920***K 8W5920***L	0761 0759	8W5920***K 8W5920***L	0762	17A036
Q5	80A920***L	0761 0759	80A920***L	0762	17A036



**Note:**

If the update does not run on the first attempt, please try again.

If the update fails for a second time, put the vehicle in bus sleep mode for at least half an hour before attempting the update process again.

## Warranty

<b>Claim Type:</b>	<ul style="list-style-type: none"><li>• 110 up to 48 Months/50,000 Miles.</li><li>• G10 for CPO Covered Vehicles – Verify Owner.</li><li>• If the vehicle is outside any warranty, this Technical Service Bulletin is informational only.</li></ul>		
<b>Service Number:</b>	9025		
<b>Damage Code:</b>	0039		
<b>Labor Operations:</b>	Software Update (Includes checking for DTCs)	0151 0000	Time stated on the diagnostic protocol (Max 125 TU)
<b>Diagnostic Time:</b>	GFF	No allowance	0 TU
	Road test prior to the service procedure	No allowance	0 TU
	Road test after the service procedure	No allowance	0 TU
<b>Claim Comment:</b>	As per TSB #2063913/2		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.



# Technical Service Bulletin

---

## Additional Information

The following Technical Service Bulletin(s) will be necessary to complete this procedure:

- TSB 2011732, *00 Software Version Management (SVM), operating instructions.*

All part and service references provided in this TSB (2063913) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2021 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.