

TECHNICAL TOPICS

POWERTRAIN



BECM offline after programming

2019-2022 Land Rover L663, L462, L550, L551, L405, L538, L494, L560 fitted with 48V Battery
2019-2022 Jaguar X540, X761, X590, X260 fitted with 48V Battery

Customer Voice:


- BECM offline after programming.

Technical Description:

- **SSM75403 or SSM75404 should be performed prior to programming the BECM**

- A BECM reset may be required to be performed if the BECM is shown offline after programming

1. Remove the main 12v Battery Earth Cable, unplug BMS Sensor
2. Remove the main 12v Positive Battery Lead,
3. Unplug ALL BECM Low Voltage Connectors,
4. Leave vehicle sitting for one hour, then proceed with
5. Connector refitting of BECM Connections,
6. Refit 12v Battery Positive Lead
7. Refit 12v Battery Earth Lead
8. Refit BMS Sensor, to earth.
9. Wait Five Minutes open the driver's door and verify BECM is Online with Pathfinder,
- 10.
11. Ensure DCDC is enabled in ECU Functions EPICD Normal mode

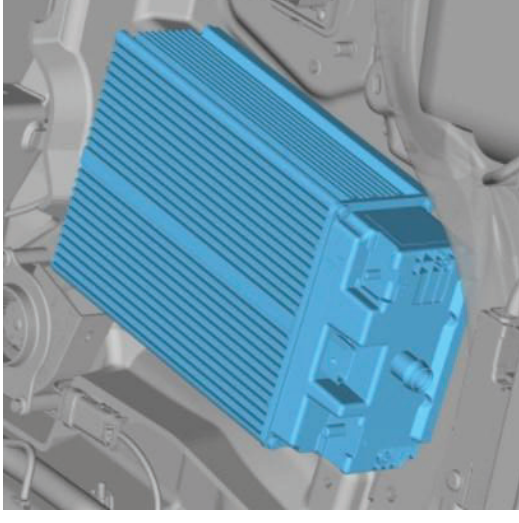

PRINTED COPIES ARE UNCONTROLLED