

# Diagnostic Trouble Codes (DTC) P2080, P2084, **P242B Lighting The Malfunction Indicator Lamp (** MIL ) - US14+OBD13 And US14+OBD15 Emissions, Model Years 2015 And 2016




> Internal Content

NO PARTS SHOULD BE REPLACED for these DTCs unless a sensor failure is confirmed.

#### Verify the chassis emissions level

- Details can be found in the Product Details box on the Product tab in PTT as seen below:

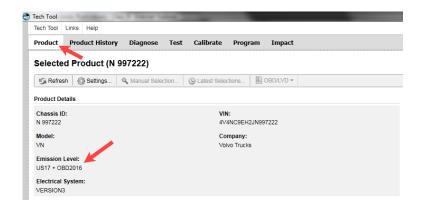

### For US14+OBD13 (Commonly Model Year 2015) Chassis:

- Software improvements have been released to address this code. If any of these codes are present, the following items should be checked and updated as necessary.
  - Engine Control Module (EMS) Main Software (MSW) part number should be 22489791 or later.
  - Parameter CWW should be set to 10.
    - o If CWW is not set to 10, the Vehicle Electronic Control Unit (VECU) needs to be programmed after the EMS.

### For OBD15 (Commonly Model Year 2016) Chassis:


- Software improvements have been released to address this code. If any of these Live UI s are present, Engine Control Module (EMS) software should be checked and

8/31/2021 Article

• Main Software (MSW) part number should be 22644015 or later.

#### If Software is current:

- Review the Detailed Status Information for the relevant code on the DTC Readout.

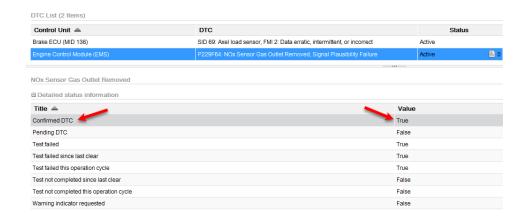

- If Confirmed DTC is **TRUE**: Proceed with diagnostics
- If Confirmed DTC is **FALSE**: Disregard and focus on other symptoms or DTCs relevant to the complaint.



k10136130

volvo

mack

8/31/2021 Article

## **Related links and attachments**

No links or attachments available



Give feedback

to help improve the content of this article