



Technical Service Bulletin

94 Hazard warning lights intermittently switch themselves on

94 21 44 2059217/2 September 1, 2021. Supersedes Technical Service Bulletin Group 94 number 20-22 dated April 10, 2020 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A8	2018 - 2020	All	Not Applicable
A8	2021	000001 - 013021	Not Applicable
A7, A6, and Q8	2019 – 2020	All	Not Applicable
RS6, RS7, SQ8, and RSQ8	2020	All	Not Applicable
A6, S6	2021	000001 - 054000	Not Applicable
A7, S7	2021	000001 - 053205	Not Applicable
RS7	2021	900001 - 906210	Not Applicable
RS6, RS6 Avant	2021	900001 - 906241	Not Applicable
Q8, SQ8, and RSQ8	2021	000001 - 025503	Not Applicable

Condition

REVISION HISTORY		
Revision	Date	Purpose
2	-	Revised header (Added Model Years)
1	04/10/2020	Initial publication

Customer states:

- Hazard warning lights activate on their own without input.
- Hazard lights may not be able to be switched off.

Workshop findings:

- No relevant DTC is stored.



Technical Service Bulletin

Technical Background

Multifunction switch assembly can incorrectly detect input from the hazard switch.

Production Solution

Improved switch assembly installed in production.

Service

1. Confirm the customer's concern using the battery history data. Battery history data can provide evidence that the hazard lights were actuated during a standing time.
2. If the time and date are close to the customer concern or the concern can be duplicated in service, replace the multifunction switch containing the hazard switch.



Tip: For customer concerns relating to false alarm activations, make sure to clarify with the customer if the alarm horn was heard or not. Alarm trigger data should be reviewed in these cases to ensure there is not another root cause.

In these cases, this TSB does not apply and continue diagnosing the cause outside of this TSB.

Warranty

Claim Type:	<ul style="list-style-type: none">• 110 up to 48 Months/50,000 Miles.• G10 for CPO Covered Vehicles – Verify Owner.• If the vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	9447		
Damage Code:	0010		
Labor Operations:	Remove and install multiple switches	9077 1950	See SRT with associated operations
Diagnostic Time:	GFF	0150 0000	Time stated on the diagnostic protocol (Max 50 TU)



Technical Service Bulletin

	Road test prior to the service procedure	No allowance	0 TU
	Road test after the service procedure	No allowance	0 TU
Claim Comment:	As per TSB #2059217/2		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Required Parts and Tools

Always check with your Parts Department and/or ETKA for the latest information and parts bulletins.		
Part Number	Part Description	Quantity
See ETKA	Fasteners, Bolts, Nuts, and Screws as needed per the Repair Manual	See ETKA/ELSA
See ETKA	Multiple Switch	01

Additional Information

All parts and service references provided in this TSB (2059217) are subject to change and/or removal.

©2021 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.