

DEALER HOLD

Release Date: September 24, 2021

SLI

Communication #: TDH-21-01

Model Year(s): 2021

— Confidential and Proprietary —

VERSION: R01 (September 24, 2021)

IMPORTANT STOP SALE NOTICE!

Stop selling affected vehicles immediately.

SUBJECT: DEALER HOLD / STOP SALE

PURPOSE

EFFECTIVE IMMEDIATELY: STOP SALE on affected Slingshot vehicles identified in your inventory. Polaris has determined that 10 Slingshot vehicles have wheel lug nuts that may not have achieved the specified torque value during the assembly process.

Affected vehicles will need to have the lug nut torque confirmed to meet specification prior to retail.

AFFECTED MODELS

MODEL YEAR	MODELS	AFFECTED RANGE
2021	T21AAPHDAB	Reference Unit Inquiry on the dealer website or the Service Communications list on the STOP site to look up affected units.
	T21AAPHDAC	
	T21AATHDAA	
	T21AASGDAA	
	T21AAPGDAB	

TDH-21-01 (R01) © 2021 Polaris Inc. Page 1 of 2

WARRANTY CLAIM INFORMATION

2021 SLINGSHOT			
Bulletin #	TDH-21-01		
Claim Type	Dealer Hold		
Labor Allowance	0.2 hours (12 minutes)		
Part Number / Description	0000541 (QTY 1) Bulletin Misc Labor		
Parts Availability	NA		
University of Polaris Video Training Required	NO		

Claim Submission:

• **US / Canada Dealers:** On DEX, go to Service and Warranty > Warranty Claim and Extended Coverage > Start a New Warranty Claim. Select Dealer Hold> Enter the VIN / PIN and Retrieve Registration. Select TDH-21-01 and Send Claim.

TDH-21-01 PROCEDURE

TOOLS REQUIRED

- · Socket Set, Metric
 - Socket Size: 17 mm (deep well)
- · Torque Wrench

REPAIR PROCEDURE

- 1. Park vehicle on a flat surface.
- 2. Shift vehicle to NEUTRAL.
- 3. Press START/STOP button to turn vehicle OFF.
- 4. Apply parking brake.
- 5. Remove key fob from proximity of vehicle.
- 6. Verify all five lug nuts of the front left wheel to the specified value.

TORQUE	
Wheel Lug Nuts: 75 ft-Ibs (102 N·m)	

7. Verify all five lug nuts of the front right wheel to the specified value.

TORQUE	
Wheel Lug Nuts: 75 ft-lbs (102 N·m)	
73 11-103 (102 14-111)	

8. Verify all five lug nuts of the rear wheel to the specified value.

TORQUE	
Wheel Lug Nuts:	
75 ft-lbs (102 N·m)	

9. Submit a Dealer Hold Warranty Claim for TDH-21-01.