

TECHNICAL TOPICS

POWERTRAIN



<p>AJ20P6 Poor Idle</p>	<p>2019-2022 Range Rover, Range Rover Sport, Defender</p>
<p><u>Customer Voice:</u></p> <ul style="list-style-type: none"> Customer symptom of idle speed instability, check engine light illuminated and associated idle control system DTC's P0505, P0506, P0507 logged in PCM. <p><u>Technical Description:</u></p> <ul style="list-style-type: none"> Torn/split rubber diaphragm of the full load breather valve in the breather cover assembly caused by a combination of mechanical stress and blow by gases. <p><u>Status:</u></p> <ul style="list-style-type: none"> Currently at the time of publication, the only repair possible is replacement of the breather cover assembly for this condition Guided diagnostics has been updated for P0507 -00 <p style="text-align: center;">Refer to Pathfinder Guided Diagnostics for P0507 -00</p>	



PRINTED COPIES ARE UNCONTROLLED