




Reduced or Lack of Steering Assistance on Start-up	20 – 21MY RR Velar, F-PACE
<p><u>Customer Voice:</u></p> <ul style="list-style-type: none"> Customers may experience a reduced or lack of power assistance at start up, for up to 30 seconds before the power assistance returns. A reduced power assistance warning message is displayed. <p><u>Technical Description:</u></p> <ul style="list-style-type: none"> The Power Steering Control Module (PSCM) software robustness on start-up can result in the module going into an error state for a period of time before a self-heal strategy is initiated, the control module will then automatically reset, resulting in recovered assistance. <p><u>Status:</u></p> <ul style="list-style-type: none"> A manual patch file for PATHFINDER has been created to change the PSCM software to address this concern.. SSM 75521 (Land Rover) and 75522 (Jaguar) has been published to address this concern. <p>Note: With this manual patch installed and after updating the PSCM software, the PSCM Assembly part number on PATHFINDER (Software parts) may be displayed as not up to date, this is correct and is due to the strategy of the manual patch, as long as the software shown is up to date, there is no requirement to select Update ECU again.</p>	 PATHFINDER JOIN THE JOURNEY



PRINTED COPIES ARE UNCONTROLLED