

## X540 Panoramic roof inoperable



If a X540 Panoramic roof sunblind becomes inoperable, lower overhead console and headliner to gain access to sunblind motor.

Insert 4mm Allen key into emergency operation slot, rotate half turn clockwise and then half turn anti clockwise.

Then operate normally by button.  
Re calibrate Panoramic roof then operate approx. 7 full cycles.

Refit overhead console and headliner as per TOPIx process.

\*\* Care point head liner creasing when lowering for access to the sunblind motor.

