

# TECHNICAL TOPICS

## ELECTRICAL



AEB warning on Instrument Panel Cluster	2020-2022 Defender
<p><u>Customer Voice:</u></p> <ul style="list-style-type: none"><li>- The Autonomous Emergency Braking (AEB) warning message is displayed on the instrument cluster (IPC).</li></ul> <p><u>Technical Description:</u></p> <ul style="list-style-type: none"><li>- Following a software update being completed using the approved Jaguar Land Rover Diagnostic service tool, there is an incorrect combination of software between the Image Processing Module A (IPMA) and the Driver Assistance Domain Controller (DADC) module.</li><li>- The DTC: U2036-57 is stored within the Driver Assistance Domain Controller (DADC) module.</li></ul> <p><u>Status:</u></p> <ul style="list-style-type: none"><li>- SSM75548 has been released with a manual patch to resolve this concern.</li><li>- The permanent corrective action is targeted for release in November via SOTA</li></ul>	

