

TECHNICAL TOPICS

POWERTRAIN



Timing chain replacement VVT Service Part Incorrectly Boxed	MY20 – MY22 Defender, Discovery, RR, MY12 – MY22 RR Evoque, MY16 - MY22 F-Pace, XF, MY17 – MY22 Velar, E-Pace, MY15 – MY22 XE, Disco Sport
<p><u>Customer Voice:</u></p> <ul style="list-style-type: none">– Customer will be unaware <p><u>Technical Description:</u></p> <ol style="list-style-type: none">1. VVT Bolt is boxed incorrectly2. Upon inspection of box contents, VVT bolts have two different lengths <p><u>Status:</u></p> <ul style="list-style-type: none">– Check bolt length and Part Number on the end face before fitting.– Correct AJ20D-4 VVT Special Bolt - Part number: LR073747/JDE36995– Petrol AJ20P-4 Found in the AJ20D-4 Parts box - Part number: LR127722/T2H42447 <p>Refer to SSM75535/SSM75534 for further information</p>	 

