



TECHNICAL TOPICS

BODY/CHASSIS



<p>Reduced or Lack of Steering Assistance on Start-up</p>	<p>21MY RR Evoque, Discovery Sport, E-PACE</p>
<p><u>Customer Voice:</u></p> <ul style="list-style-type: none"> Customers may experience a reduced or lack of power steering assistance, with a “Steering Assistance Reduced” message displayed on the instrument cluster. <p><u>Technical Description:</u></p> <ul style="list-style-type: none"> The steering assistance will drop to 50% for 10 seconds and then 0% but after the ignition is cycled the steering assistance and related features will return to normal, due to an issue with the Power Steering Control Module (PSCM) software robustness. <p><u>Status:</u></p> <ul style="list-style-type: none"> New PSCM software has been created to address this concern, released on PATHFINDER 345. Update Prior to Sale Campaign UPS8021-1B / Service Action N614NAS1 (Land Rover) and UPS7921-1B / Service Action H367NAS1 (Jaguar) has been launched to proactively address this concern. SSM 75542 (Land Rover) and 75357 (Jaguar) has been published to address this concern. 	 <p>PATHFINDER </p> <p>JOIN THE JOURNEY</p>

