



TECHNICAL TOPICS

BODY/CHASSIS



<p>Reduced or Lack of Steering Assistance on Start-up</p>	<p>20 – 21MY RR Velar, F-PACE</p>
<p><u>Customer Voice:</u></p> <ul style="list-style-type: none"> Customers may experience a reduced or lack of power assistance at start up, for up to 30 seconds before the power assistance returns. A reduced power assistance warning message is displayed. <p><u>Technical Description:</u></p> <ul style="list-style-type: none"> The Power Steering Control Module (PSCM) software robustness on start-up can result in the module going into an error state for a period of time before a self-heal strategy is initiated, the control module will then automatically reset, resulting in recovered assistance. <p><u>Status:</u></p> <ul style="list-style-type: none"> SSM 75521 (Land Rover) and 75522 (Jaguar) had been published to address this concern, providing instructions for a manual patch file. These SSMs have been removed since the latest PATHFINDER release has the updated PSCM software to address the concern without the need for a manual patch file. Should a customer express a concern, please follow the Guided Flow for the system fault. 	 <p>PATHFINDER </p> <p>JOIN THE JOURNEY</p>

