



Technical Service Bulletin

PSS 91 SOS emergency call malfunction, DTC B129B11 and B129C11 are stored in the emergency call control module

91 21 47 2061625/3 November 3, 2021. Supersedes Technical Service Bulletin Group 91 number 21-67 dated February 17, 2021 for reasons listed below.

| Model(s) | Year | VIN Range | Vehicle-Specific Equipment |
|--|-------------|-----------|----------------------------|
| A4, S4, A4 allroad, A5, A5 Cabriolet, A5 sportback, S5, S5 Cabriolet, and S5 sportback | 2020 - 2021 | All | ConBox |
| A6, A6 allroad, A6 Avant, S6, RS 6 Avant, A7, S7, RS 7, A8, S8, Q5, SQ5, Q7, SQ7, Q8, SQ8, RS Q8, RS 5, RS 5 Cabriolet, RS 5 sportback, Audi e-tron quattro, and Audi e-tron sportback quattro | 2021 | All | ConBox |

Condition

| REVISION HISTORY | | |
|------------------|------------|--|
| Revision | Date | Purpose |
| 3 | - | Revised <i>Service</i> (Updated expected release date) |
| 2 | 02/17/2021 | Revised header (Added models) |
| 1 | 12/09/2020 | Initial publication |



Technical Service Bulletin

Customer states:

- The message “SOS – Emergency call malfunction, please contact service” is displayed in the instrument cluster.

Workshop findings:

The following DTCs are stored in the control module for emergency call module and communication unit, J949 (address word 0075):

- **DTC B129B11** (microphone 1, short circuit to ground).
- **DTC B239C11** (microphone 2, short circuit to ground).



Note:

While a warning message is displayed in the instrument cluster, the e-Call functionality remains active.

Technical Background

A software malfunction can cause the aforementioned DTCs to be entered erroneously.

Production Solution

This bulletin will be updated when more information is available. A solution is currently under development.

Service

1. Clear the DTCs.
2. Explain to the customer that a solution is forthcoming for the 1st quarter of 2022 and that no repairs are necessary at this point. Do not replace any components for this condition since this will not resolve the customer's concern.
3. Create a PSS record in the PSS application through the Pending Service Solutions (PSS) link in AccessAudi (under *Related Links >> Service*), or through the Technical Assistance page in Elsa.

Warranty

| | |
|--------------------|---|
| Claim Type: | <ul style="list-style-type: none">• 110 up to 48 Months/50,000 Miles.• G10 for CPO Covered Vehicles – Verify Owner.• If the vehicle is outside any warranty, this Technical Service Bulletin is informational only. |
|--------------------|---|



Technical Service Bulletin

| | | | |
|-------------------------|--------------------------------------|--------------|--|
| Service Number: | 9170 | | |
| Damage Code: | 0039 | | |
| Diagnostic Time: | GFF | 0151 0000 | Time stated on the diagnostic protocol (Max 25 TU) |
| | Road test prior to service procedure | No allowance | 0 TU |
| | Road test after service procedure | No allowance | 0 TU |
| Claim Comment: | As per TSB #2061625/3 | | |

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

All part and service references provided in this TSB (2061625) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2021 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.