

SUBJECT:

Technical Service Bulletin

EXCESSIVE INTERMITTENT MOVEMENT IN DRIVER'S POWER SEAT - REVISED

No: **TSB-21-52A-002**

DATE: October 2021

MODEL: 2007-19 Outlander, 2018-19 Outlander PHEV, 2011-19 Outlander Sport/RVR

			··· ••••••••••••••••••••••••••••••••••
CIRCULATE TO:	[] GENERAL MANAGER	[X] PARTS MANAGER	[X] TECHNICIAN
[X] SERVICE ADVISOR	[X] SERVICE MANAGER	[X] WARRANTY PROCESSOR	[] SALES MANAGER

This bulletin supersedes TSB-19-52A-004, issued October 2019, and updates the procedures to help resolve the power seat movement. Revisions are italicized and indicated by ◀.


PURPOSE

Some customers may notice excessive intermittent movement of the driver's power seat, typically when accelerating or decelerating. Further production changes have been implemented to address this seat movement.

This TSB instructs dealers to replace the seat adjuster assembly and power seat harness in affected vehicles with improved countermeasure parts. Due to a change in the reclining motor, the new longer harness and connector are necessary.

BACKGROUND


Height adjustment linkages in the seat adjuster assembly may loosen over time with normal driving and allow movement. A new seat adjuster was implemented in production at the supplier from March 2, 2016, and has added metal bushings at the 6 rotational connections on the seat frame, as shown below.

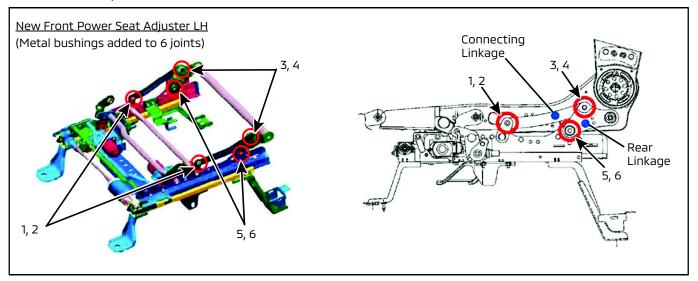


Copyright 2021, Mitsubishi Motors North America, Inc.

The information contained in this bulletin is subject to change. For the latest version of this document, go to the Mitsubishi Dealer Link, MEDIC, or the Mitsubishi Service Information website (*www.mitsubishitechinfo.com*).

The clearance of the slide rail and rubber damper has also been changed in production at the supplier starting September 19, 2018. Refer to the VINs listed in Affected Vehicles.

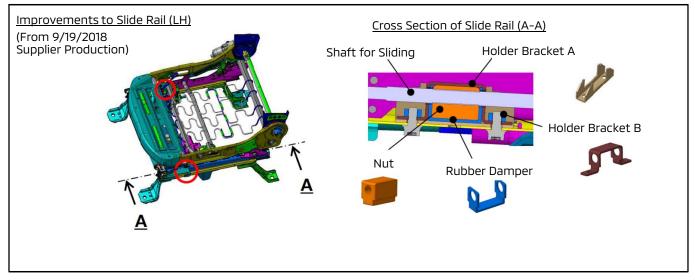

The clearance of the bearing plate hole size has also been changed in production at the supplier starting May 10, 2021. Refer to the VINs listed in Affected Vehicles.

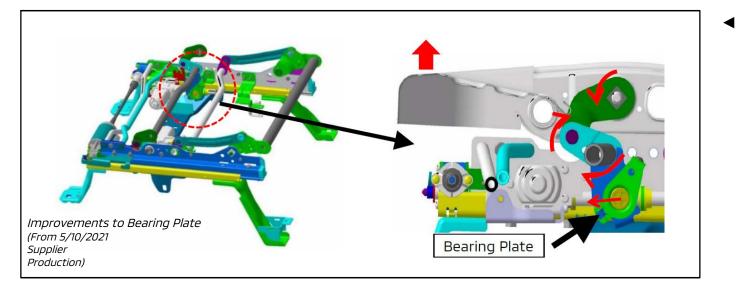

AFFECTED VEHICLES

Outlander:

- All 2007 2016 Outlander
- 2017 2019 Outlander built **before** and **including** the ending VINs as listed below:

Model Year	Country	Plant*	Engine	Ending VIN
			2.4 L	KZ013434
2017 - 2019	USA		3.0 L	KZ013608
2017 - 2019	Canada	Okazaki	2.4 L	KZ604199
			3.0 L	KZ604195
2016	Mexico		2.4 L	GZ036168
2018 - 2019			2.4 L	KJ000744
	USA	DMC	3.0 L	KJ000743
2018	Canada	PMC	2.4 L	JJ601177
	Canada		3.0 L	JJ601172

* To identify production plant, see 7th digit from end of VIN. Z = Okazaki, U = Mizushima, J = PMC

Outlander PHEV:

• 2018 - 2019 Outlander PHEV built before and including the ending VINs as listed below:

Model Year	Country	Plant	Ending VIN
2018 - 2019	USA	Okazaki	KZ034619
	Canada	UKazdKI	KZ606610

* To identify production plant, see 7th digit from end of VIN. Z = Okazaki, U = Mizushima, J = PMC

Outlander Sport:

• 2011 - 2019 Outlander Sport/RVR built **before** and **including** the ending VINs listed below:


Model Year	Country	Engine	Ending VIN		
2011 - 2019	USA	2.0 L	KU012241		
	USA	2.4 L	KU010778		
	Canada	2.0 L	KU601552		
	Canada	2.4 L	KU601555		

REPAIR PROCEDURE

1. If a customer reports excessive movement of the driver's power seat on the vehicles listed in this TSB, replace the front power seat adjuster assembly and the power seat harness with the new countermeasure parts. Refer to the Parts Information section in this TSB for the correct part number for each vehicle.

For detailed replacement instructions, refer to the applicable Service Manual:

- Group 52A-Interior -> Seat Assembly -> Front Seat Assembly -> Removal and Installation
- Group 52A-Interior -> Seat Assembly -> Front Seat Assembly -> Disassembly and Reassembly.

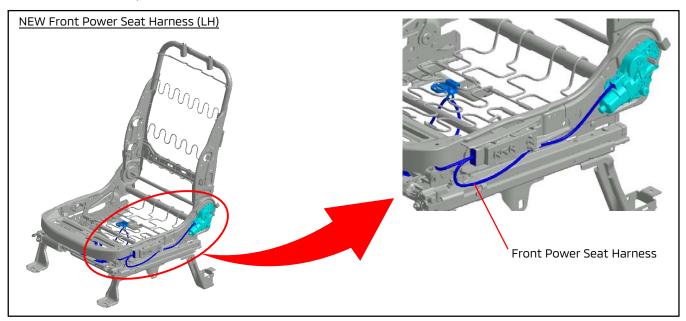

2. Verify proper operation of all front power seat assembly functions, and verify that the movement concern has been resolved.

PARTS INFORMATION

Use only the Genuine Mitsubishi Parts listed below.

NOTE: Refer to Affected Vehicles section for ending VINs of vehicles needing countermeasure parts.

Description	Model	Model Year	NEW Part Number	Old Part Number	Qty
Front Power Seat Adjuster, LH	Outlander	2007-2019	6922A207	6922A119	1
	Outlander PHEV	2018-2019	6922A211	N/A	1
	Outlander Sport/RVR	2011-2019	6922A237	6922A037	1

Description	Model	Model Year	Part Number	Qty
	Outlander	2007-2019		1
Front Power Seat Harness, LH	Outlander PHEV	2018-2019	6979A709	1
	Outlander Sport/RVR	2011-2019		1

WARRANTY INFORMATION

This bulletin is supplied as technical information only and is not an authorization to repair. If an affected vehicle is reported with the described condition, diagnose the condition, repair as described in this bulletin and submit a normal warranty claim using the following information.

Labor Operation Code	Description	Nature Code	Cause Code	Model	Model Year	Time Allowance
52115210		60D	450	Outlander	2007-2013	1.1
	Replace Front Power Seat Adjuster Assembly & Seat				2014-2019	1.3
				Outlander PHEV	2018-2019	1.3
	Harness			Outlander Sport/RVR	2011-2019	1.3

Warranty Coverage: 5/60 Basic Coverage