Service Alert

Mazda North American Operations Irvine, CA 92618-2922



Subject:

INFOTAINMENT REBOOT / SLOW REBOOT IN MORNING/ DISPLAY FROZEN / DISPLAY BLANK AND REAR VIEW MONITOR OPERATION NORMAL

Service Alert No.: SA-054/21

Last Issued: 11/16/2021

BULLETIN NOTES

APPLICABLE MODEL(S)/VINS

2021 Mazda3

2021 CX-30

2021 CX-5

2021 CX-9

2022 MX-30

DESCRIPTION

Some customers may complain about any the following infotainment system concerns:

- Reboot
- · Slow reboot in morning
- · Display frozen
- · Display blank

NOTE:

- · Rear view monitor operation is normal
- · No DTC stored

REPAIR PROCEDURE

- 1. Verify customer concern.
- 2. Check for DTCs.

Is DTC stored?

- YES: This service information does not apply. Go to normal MGSS DTC diagnosis.
- NO: Go to next step.
- 3. Retrieve 6 digit CMU Serial Number. Go to "CMU Serial Number Retrieval"

Is the CMU Serial Number within the affected range? See "Affected CMU Serial Number Range" table.

- YES: Contact Hotline for additional support.
- NO: This service information does not apply. Go to MGSS SA-027/21 diagnostics.


Page 1 of 3

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "doit-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

Service Alert No.: SA-054/21 Last Issued : 11/16/2021

4. Verify repair.

CMU Serial Number Retrieval

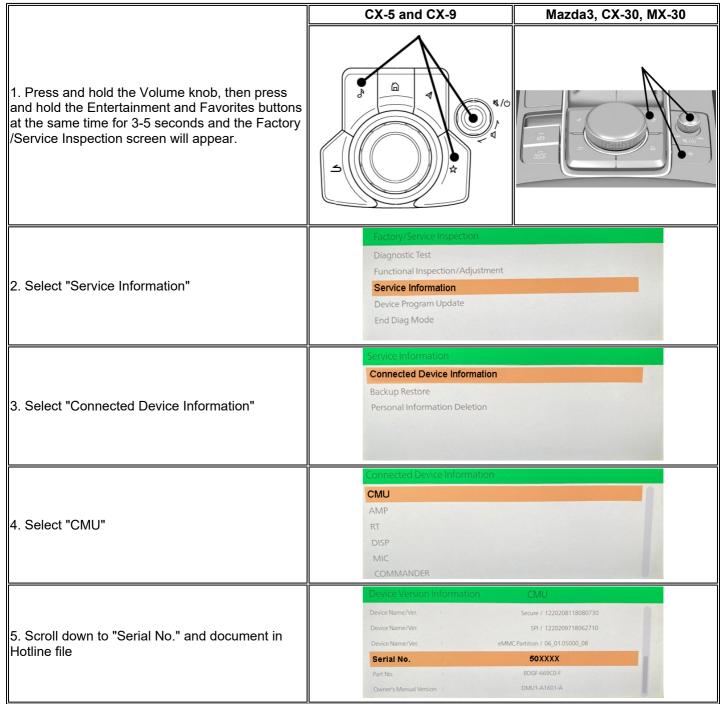

Page 2 of 3

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "doit-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

Service Alert No.: SA-054/21 Last Issued : 11/16/2021

6. Return to Factory/Service Inspection main screen and select End Diag Mode

Factory/Service Inspection main Service Inspection main Device Program Update

End Diag Mode

Affected CMU Serial Number Range

Allocios omo obrisi resingo			
Model	Serial Number Start	Serial Number End	Part Number
MX-30	500125	500664	DN4E 66 9C0-C
CX-5 and CX-9	687234	754800	TC3P 66 9C0-F
Mazda3 (Japan built)	622110	624748	BDGF 66 9C0-W
Mazda3 (Japan built)	500070	505859	BGMC 66 9C0-D
Mazda3 (Mexico built) and CX-30	216848	227361	DGH9 66 9C0-J
Mazda3 (Mexico built) and CX-30	104005	121788	DGMR 66 9C0-D
Mazda3 Turbo (Japan built)	TBD	TBD	BFWM 66 9C0-*
Mazda3 Turbo (Mexico built) and CX-30 Turbo	111827	113170	BGCE 66 9C0-B

Page 3 of 3

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.