



---

# SERVICE BULLETIN

---

Classification: EL21-015	Reference: NTB21-093	Date: October 6, 2021
-----------------------------	-------------------------	--------------------------

## WATER INTRUSION INTO REAR COMBINATION LAMP CAN CAUSE MULTIPLE DTCS AND NO-START CONDITION

**APPLIED VEHICLES:** 2016-2021 Titan/Titan XD (A61)

### SERVICE INFORMATION

Water intrusion into one or both of the rear combination lamp assemblies can cause multiple DTCs, and possibly cause the vehicle's engine to not start. Water intrusion into one or both rear combination lamp assemblies has been found to migrate through the harness, and can cause harness connector terminals in C1/E41 to corrode (Figure 1 on page 2).

- Repair any damaged rear combination lamp assemblies immediately to avoid potential harness damage.

#### **NOTICE**

Harness connector terminals in C1/E41 found to be damaged through water intrusion due to a damaged rear combination lamp assembly is not warrantable.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. **NOTE:** If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

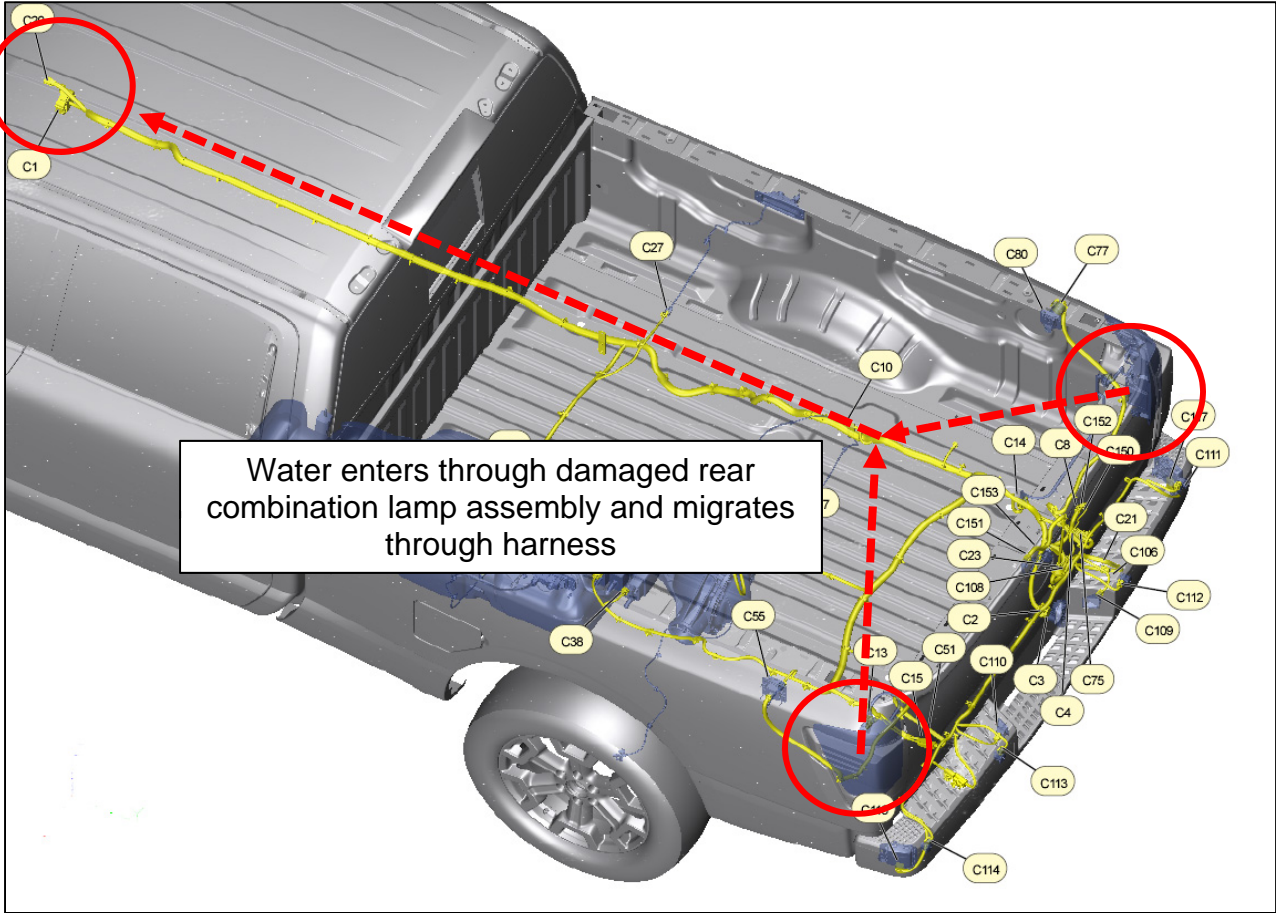


Figure 1

**AMENDMENT HISTORY**

PUBLISHED DATE	REFERENCE	DESCRIPTION
October 6, 2021	NTB21-093	Original bulletin published