



## Diagnostic Trouble Code (DTC) U3017 - OBD2015/16 Model Year ( MY ) 2016/2017 Vehicles



### > Internal Content

Reports are being received that OBD2015/16 (MY-2016/2017) Trucks are logging U3017 Fault Code (DTC)

We have seen a number of vehicles logging U3017 DTCs intermittently (In certain cases causing MIL Lamp on). We are investigating reasons for this fault code and planning a software release to resolve this issue.

Impacted EECU MSW's:

- OBD2015 (Truck MY 2016) - 22741784.P01 or older software
- OBD2016 (Truck MY 2017) - 22898389.P01 or older software

### Recommended Actions:

- Clear fault code and inform customer that a software fix will be available approximately July 2016, time frame. The lower number of startup / shutdowns will lessen the chance of the MIL Lamp coming on.
- Typically we have seen the fault to happen during startup (~18 minutes after start) and fault becomes inactive during normal continuous engine running of ~36 minutes.

**Do not replace any component for this fault code at this time. Replacing the Engine ECU or Instrument Cluster will not make any significant difference in removing this fault code.**



Tags

[k40525473](#)

[volvo](#)

[mack](#)

### Related links and attachments

No links or attachments available



### Feedback

[Give feedback](#)

to help improve the content of this article