


TECHNICAL TOPICS

ELECTRICAL

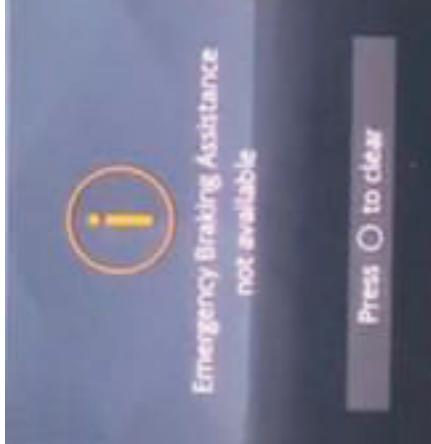

AEB warning on Instrument Panel Cluster	2020-2022 Defender
<p><u>Customer Voice:</u></p> <ul style="list-style-type: none">– The Autonomous Emergency Braking (AEB) warning message is displayed on the instrument cluster (IPC). <p><u>Technical Description:</u></p> <ul style="list-style-type: none">– Following a software update being completed using the approved Jaguar Land Rover Diagnostic service tool, there is an incorrect combination of software between the Image Processing Module A (IPMA) and the Driver Assistance Domain Controller (DADC) module.– The DTC: U2036-57 is stored within the Driver Assistance Domain Controller (DADC) module. <p><u>Status:</u></p> <ul style="list-style-type: none">– SSM75548 has been released with a manual patch to resolve this concern.– The permanent corrective action is targeted for release by SOTA with Update 3.1.0	 A photograph of a car's instrument cluster displaying a warning message. The screen is dark blue with a large yellow exclamation mark icon in the center. To the right of the icon, the text "Emergency Braking Assistance not available" is visible. At the bottom right of the screen, there is a button labeled "Press O to clear".



PRINTED COPIES ARE UNCONTROLLED