

Reference	SSM75622
Models	E-PACE / X540 F-PACE / X761 I-PACE / X590 XE / X760 XF / X260
Title	Fuel Flap locking not working. BCM DTC B1C91 logged.
Category	Electrical
Last modified	26-Nov-2021 00:00:00
Symptom	203000 Basic Electrical
Content	<p>Affected models X260 22MY X540 22MY X590 22MY X760 22MY X761 22MY</p> <p><u>Issue:</u></p> <p>Customers may complain of fuel flap remains unlocked when vehicle locked. Retailer investigate and determine DTC B1C91 present in BCM</p> <p><u>Cause:</u></p> <p>New BCM design intent introduced due to world wide chip shortage.</p> <p><u>Action:</u></p> <p>If the DTC is logged in the BCM request GDS support to ensure the CCF parameter 0x5167 LockFuelFillFlap is set to 0x01 (not fitted) instead of 0x02 (fitted)</p>

anBhdHRIcnM7MjAyMS0xMj0wMjQxMzoyMjowNj0wMDRzOzE2NS4yMjUuNTYuMjIwOw==