

**SIB 61 11 04**

2021-11-24

Incorrect spare fuses were included in the tool kit - Bulletin 61 011 04 (100)

This Service Information Bulletin replaces SI 61 011 04 (100) **dated November 2004**.

The contents of this bulletin have not changed; bulletin numbering was updated.

MODEL

This document applies to the following Motorrad AG models: 0555

This document applies to the following Motorrad model descriptions: K 1200 LT US

This document applies to the following Motorrad series: K589

SITUATION

This document is applies to the following categories: General Electrical Systems

Supporting Materials

[picture_as_pdf 61 011 04 \(100\) Incorrect fuses in tool it, K 1200 LT.pdf](#)

Dealer Operation/ General Manager	Sales- Motorcycles	Sales - Used Motorcycles	Business Manager (F&I)	Service	Parts & Accessories	Administration
Date: November 2004 Bulletin # 61 011 04 (100)		Source: 61 79/2004 Name: Pat Raymond Title: Service and Technical Manager				



BMW Motorrad USA

Service Information Bulletin

Subject: Incorrect spare fuses were included in the tool kit, 2005 K 1200 LT.

Details: With the introduction of the new watertight fuse box a change was made from large type fuses to mini fuses. While the correct fuses are installed in the fuse box, the older, large type fuses were supplied in the on-board tool kit.

Production Solution: Tool kits with the correct mini fuses, and matching fuse puller, have been supplied in K 1200 LT production as of February 03, 2004.

Aftersales Solution: During the Pre-Delivery Inspection, or on the next scheduled service appointment, check all K 1200 LTs that fall within the VIN range noted below. In the on-board tool kit replace the large type fuses with the correct mini fuses and matching fuse puller as required.

Model	Starting VIN	Ending VIN
2005 K 1200 LT	ZL 70000	ZL 70081

Warranty: Covered under the term of the New Motorcycle Limited Warranty.

To receive reimbursement enter a regular warranty claim using the warranty claim keys noted below:

Special Defect Code: 00 61 23 00 00

Description: Incorrect fuses in tool kit.

Flat Rate Code: 61 99 000

Description: No flat rate

FRUs: 3 FRUs

Parts:

Description:	Part Number:
Mini-fuse 4A	61 13 6 917 400
Mini-fuse 7.5A	61 13 6 917 402
Mini-fuse 10A	61 13 6 917 403
Mini-fuse 15A	61 13 6 917 404
Fuse puller	61 13 7 668 722

Contact: Respective Aftersales Business Consultant