



# Service Bulletin

Bulletin No.: 21-NA-271

Date: November, 2021


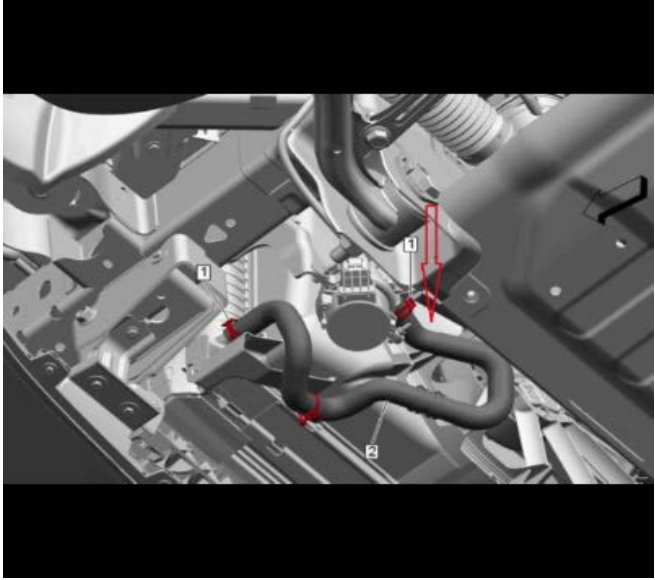
## INFORMATION

**Subject:** Information on Malfunction Indicator Lamp (MIL) Illuminated - DTC P026A Set

**This bulletin replaces PIP5745A. Please discard PIP5745A.**

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	Escalade models	2021	2022			LM2	
Chevrolet	Silverado 1500	2020				LM2	
	Suburban	2021				LM2	
	Tahoe	2021				LM2	
GMC	Sierra 1500	2020				LM2	
	Yukon models	2021				LM2	

<b>Involved Region or Country</b>	North America, Uzbekistan, Russia, Middle East, Chile, Columbia, Ecuador, Paraguay, Peru, Uruguay, Japan, S. Korea, Thailand, Australia, New Zealand.
<b>Condition</b>	Some customers may comment that the MIL is illuminated. Some technicians may find DTC P026A set in the Engine Control Module (ECM).
<b>Cause</b>	This may be due to a kinked hose at or near the low temperature auxiliary coolant pump.

<p><b>Correction</b></p>	 <p style="text-align: right;">5635568</p> <p>If this condition is encountered, loosen the hose clamp and rotate the hose to allow for proper coolant flow.</p>  <p style="text-align: right;">5635679</p>
--------------------------	---

<p><b>Version</b></p>	<p>1</p>
<p><b>Modified</b></p>	<p>Released November 19, 2021</p>

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY  
TECHNICIAN  
CERTIFICATION